

LOC/DME I-CFU <u>108.3</u> Chan 20	APP CRS 331°	Rwy Idg 5500 TDZE 217 Apt Elev 236
--	------------------------	---

ILS or LOC RWY 33

RICHMOND EXEC/CHESTERFIELD COUNTY (FCI)


T When local altimeter setting not received, use Richmond Intl altimeter setting; increase DA to 453 feet; increase all MDAs 40 feet and S-LOC 33 visibility Cat C/D $\frac{1}{8}$ SM and Circling visibility Cat D $\frac{1}{4}$ SM. **A** NA VDP NA with Richmond Intl altimeter setting.

MALSR



MISSED APPROACH: Climb to 800, then climbing left turn to 2000 via heading 148° and RIC VORTAC R-223 to MATOX INT/RIC 16.3 DME and hold.

AWOS-3PT 128.625	POTOMAC APP CON 126.75 307.2	CLNC DEL 124.6	UNICOM 123.05 (CTAF) 0
----------------------------	--	--------------------------	----------------------------------

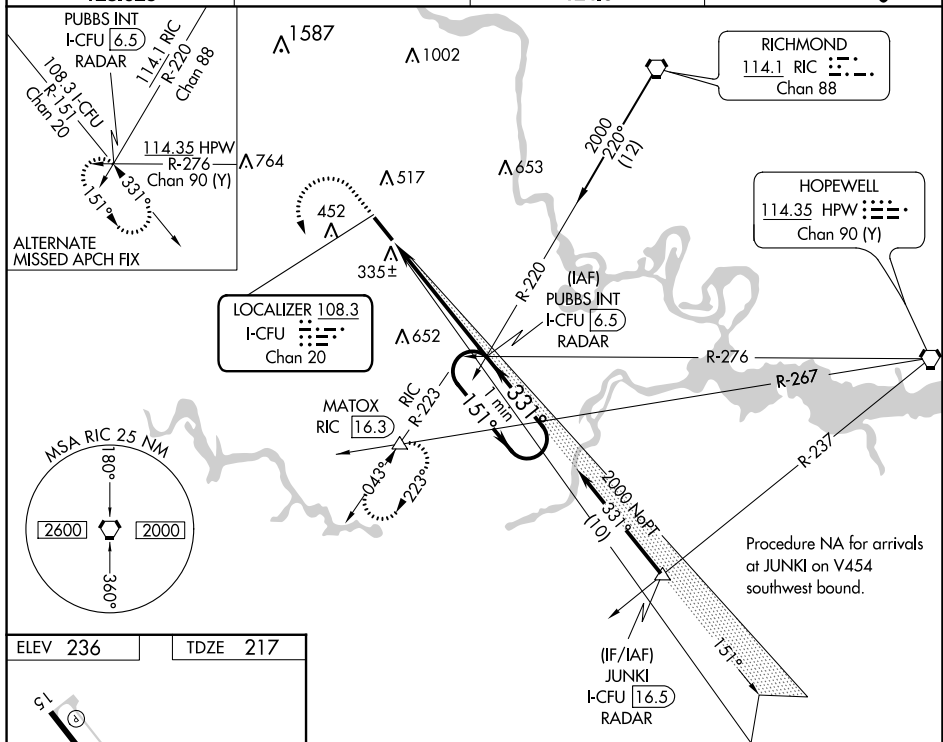

*LOC only. *I-CFU [2.4] PUBBS INT I-CFU [6.5] RADAR				
800 2000 RIC R-223 MATOX △				
One Minute Holding Pattern				
151° → 2000 ← 331° 2000 GS 3.00° TCH 49				
1.3 NM 4.1 NM				
CATEGORY	A		B	
S-ILS 33	417-½ 200 (200-½)			
S-LOC 33	660-½ 443 (500-½)		660-¾ 443 (500-¾)	
CIRCLING	720-1 484 (500-1)	760-1 524 (600-1)	760-1½ 524 (600-1½)	1020-2½ 784 (800-2½)