


WAAS CH 63141 W36A	APP CRS 022°	Rwy ldg TDZE 3400 Apt Elev 275
--	------------------------	--

RNAV (GPS) RWY 36


MANLEY HOT SPRINGS (MLY)(P.AML)

RNP APCH.	When Tanana altimeter setting not received, procedure NA. Circling NA west of Rwy 18-36. Rwy 36 helicopter visibility reduction below ¾ SM NA. Procedure NA at night.	MISSED APPROACH: Climbing right turn to 4400 direct OLSEE and hold.
-----------	--	---

TAL/PATA ASOS 135.1	ANCHORAGE CENTER 120.9 319.2	FAIRBANKS RADIO 122.3 122.65	UNICOM 122.8 (CTAF) 0
-------------------------------	--	--	--

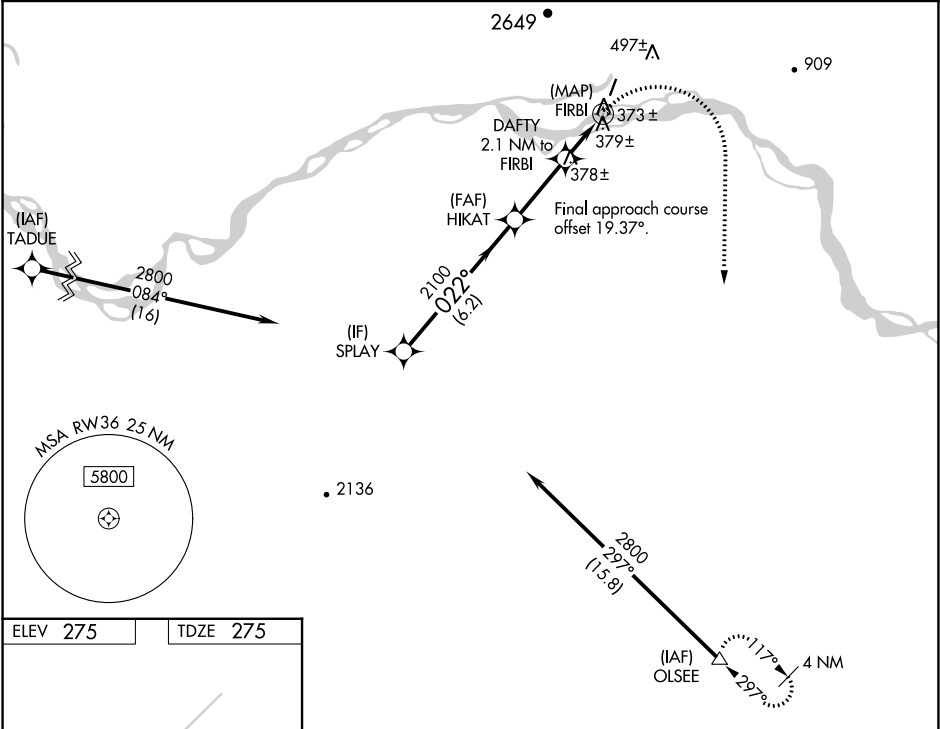

ELEV 275	TDZE 275
----------	----------

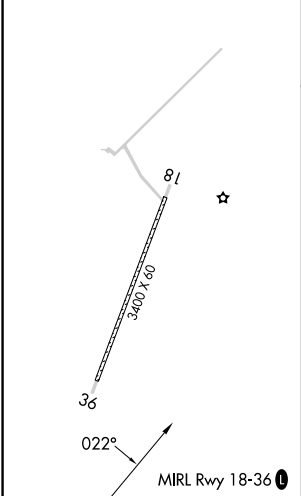

SPLAY		HIKAT		4400	OLSEE
2800		2100		1200	
022°		2.98° TCH 40		2.1 NM to FIRBI	
6.2 NM		2.8 NM		0.7 NM	
CATEGORY	A	B	C	D	
LP MDA	720-1	445 (500-1)	720-1 3/8 445 (500-1 3/8)	NA	
LNAV MDA	1020-1 745 (800-1)	1020-1 1/4 745 (800-1 1/4)	1020-2 745 (800-2)	NA	
CIRCLING	1140-1 1/4 865 (900-1 1/4)	1280-1 1/4 1005 (1100-1 1/4)	1580-3 1305 (1400-3)	NA	