KASILOF (5KS) 2 N UTC-9(-8DT) N60°21.03′ W151°15.77′

125 NOTAM FILE ENA

RWY 01-19: 2400X60 (GRVL)

RWY 01: Trees.

RWY 19: Brush.

AIRPORT REMARKS: Unattended. Maint ireg. Rwy cond unmnt, rcmnd visual insp prior to use. ATV tfc on rwy. Rwy 01–19 3 in ruts. Rwy 01 edge not mkd. Windsock blw tree line and may be unrel. Prkg area S end.

AIRPORT MANAGER: 907-953-6733

 ${\color{red}\textbf{COMMUNICATIONS: CTAF}\ 122.5}$

RADIO AIDS TO NAVIGATION: NOTAM FILE ENA.

KENAI (H) (H) VORW/DME 117.6 ENA Chan 123 N60°36.88′ W151°11.71′ 168° 16.0 NM to fld. 115/19E.

VOR unusable:


348°-015° byd 20 NM

DME unusable:

355°-041° byd 35 NM blo 2,000′

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial

1-866-864-1737. Kenai FSS-283-7211.

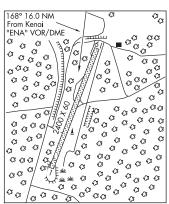

KATMAI NATIONAL PARK

LAKE BROOKS SPB (5Z9) 0 W UTC-9(-8DT) N58°33.29′ W155°46.64′

KODIAK

141

ANCHORAGE

36 NOTAM FILE ENA

WATERWAY ALL-WAY: 5000X4000 (WATER)

SEAPLANE REMARKS: Unattended. Fuel available at AKN on the river. 907–246–3079 or 130.10. Acft maint 1,000′ AGL in vicinity of Brooks Camp. Heavy bear and human concentration. Landing and takeoffs or taxing within 50 yards of bears is prohibited. Surface ops are limited to idle maneuvers within 200 yards of Brooks Camp Beach on Naknek Lake. Step taxi ops, initiation of takeoffs and landings within this zone is prohibited. Buoys note no–wake area. Large white buoys 4′ tall in waterway are a hazard to navigation and difficult to see.

AIRPORT MANAGER: 907-246-3305 COMMUNICATIONS: CTAF 122.9

RADIO AIDS TO NAVIGATION: NOTAM FILE AKN

KING SALMON (H) (H) VORTACW 112.8 AKN Chan 75 N58°43.48' W156°45.14′ 092° 32.2 NM to fld. 95/16E.

TACAN antenna offset 150' se

TACAN AZIMUTH unusable:

130°-140° byd 13 NM blo 4,000′

130°-140° byd 30 NM

332°-348° byd 19 NM blo 5,000′

DME unusable:

332°-348° byd 19 NM blo 5,000′

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737.

KAVIK RIVER

KAVIK STRIP (RK1) 60 W UTC-9(-8DT) N69°40.61′ W146°54.00′

POINT BARROW H-1A. L-4J

RWY 08-26: 5500X150 (GRVL-DIRT)

RWY 08: Road. RWY 26: Brush.

SERVICE: FUEL 100LL, JET A

668 NOTAM FILE SCC

AIRPORT REMARKS: Attended continuously. Rwy sfc is loose grvl and rocks, mid section of rwy is fairly smooth, first 1500 ft of both rwy ends are rough due to frost heaves. Rwy 08–26 thr markers non standard, barrels and reflective cones.

AIRPORT MANAGER: 404-857-4707 COMMUNICATIONS: CTAF 122.9

COMM/NAV/WEATHER REMARKS: Local call to Deadhorse FSS dial 659-2401. For a toll free call to Fairbanks FSS dial 1-866-248-6516.

KAVIK STRIP (See KAVIK RIVER on page 141)