

**QUINCY MUNI** (2J9) 2 NE UTC-5(-4DT) N30°35.87' W84°33.45'

**JACKSONVILLE**

221 B NOTAM FILE GNV

L-21D, 22I

**RWY 14-32:** H2974X75 (ASPH) S-20 PCN 9 F/A/Y/T MIRL

IAF

0.7% up NW

**RWY 14:** PAPI(P2R)—GA 3.0° TCH 20'. Thld dspcld 267'. Trees. Rgt tfc.

**RWY 32:** PAPI(P2L)—GA 3.0° TCH 21'. Thld dspcld 322'. Trees.

**RUNWAY DECLARED DISTANCE INFORMATION**

**RWY 14:** TORA-2964 TODA-2964 ASDA-2964 LDA-2700

**RWY 32:** TORA-2964 TODA-2964 ASDA-2755 LDA-2431

**SERVICE:** S4 FUEL 100LL LGT Actvt PAPI Rwy 14 & 32; MIRL Rwy 14-32—CTAF.

**AIRPORT REMARKS:** Attended 1300Z†-dusk. Parachute Jumping. Deer invof movement areas. PAJA ops; glider ops blw 10,000 ft on and invof arpt.

**AIRPORT MANAGER:** 850-643-7752

**WEATHER DATA SOURCES:** AWOS-3PT 118.975 (850) 627-6264.

**COMMUNICATIONS:** CTAF/UNICOM 122.7

Ⓜ **TALLAHASSEE APP/DEP CON** 128.7 (1100-0400Z†)

**JACKSONVILLE CENTER APP/DEP CON** 128.625 (0400-1100Z†)


**CLEARANCE DELIVERY PHONE:** For CD ctc Tallahassee Apch at 850-942-8311, when Apch clsd ctc Jacksonville ARTCC at 904-845-1592.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE TLH.

**SEMINOLE (VH) (H) VORTAC** 117.5 SZW Chan 122 N30°33.37' W84°22.44' 283° 9.8 NM to fld. 178/2E.

VOR unusable:

- 006°-034° byd 40 NM
- 050°-052° byd 40 NM
- 060°-062° byd 40 NM
- 065°-068° byd 40 NM
- 071°-075° byd 40 NM
- 096°-099° byd 40 NM
- 103°-107° byd 40 NM
- 156°-161° byd 40 NM
- 175°-177° byd 40 NM
- 180°-190° byd 40 NM blo 18,000'
- 212°-216° byd 40 NM
- 220°-223° byd 40 NM
- 241°-243° byd 40 NM
- 253°-255° byd 40 NM
- 261°-270° byd 40 NM
- 274°-301° byd 40 NM
- 278°-288° byd 7 NM blo 1,900'
- 302°-312° byd 40 NM blo 2,000'
- 302°-312° byd 58 NM
- 318°-352° byd 40 NM

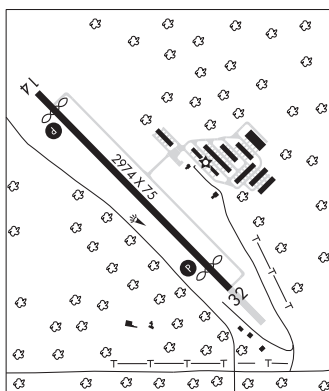

**REYNOLDS** N29°58.02' W81°39.46' NOTAM FILE GNV.

**MIAMI**

**NDB (MHW)** 338 RYD 162° 162.6 NM to Treasure Coast Intl. 16/7W.

H-8I, L-24F

**RIVER RANCH RESORT** (2RR) 0 NW UTC-5(-4DT) N27°46.76' W81°12.24'

**MIAMI**

55 B NOTAM FILE PIE

L-21D, 24F

**RWY 16-34:** H4950X75 (ASPH)

**RWY 16:** Thld dspcld 200'. Trees.

**RWY 34:** Thld dspcld 1000'. Tree. Rgt tfc.

**SERVICE:** FUEL 100LL

**AIRPORT REMARKS:** Attended continuously, 30' brush and trees 125' from centerline both sides of rwy. Unlgtgd obstns, trees 120 ft left of cntrln & 315 ft bfr AER Rwy 16. Rwy 16-34 thld markings have incorrect spacing. Rwy 16-34 has wdspcr cracking and producing loose aggregate. Rwy 16-34 markings faded.

**AIRPORT MANAGER:** 863-692-1321

**COMMUNICATIONS:** CTAF/UNICOM 122.8

**CLEARANCE DELIVERY PHONE:** For CD ctc Miami ARTCC at 305-716-1731.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE VRB.

**TREASURE (H) (H) VORTACW** 117.3 TRV Chan 120 N27°40.70' W80°29.38' 286° 38.5 NM to fld. 19/7W.

TACAN AZIMUTH OTS indef

**ROSCOE FLD** (See PENSACOLA on page 156)