

ROANOKE RAPIDS

HALIFAX/NORTHAMPTON RGNL (IXA)(KIXA) 8 S UTC-5(-4DT) N36°19.79' W77°38.11'

WASHINGTON
H-9C, 12H, L-35C, 36G
IAP

144 B NOTAM FILE IXA
RWY 02-20: H5500X100 (ASPH) S-45, D-65 HIRL
RWY 02: REIL. PAPI(P2L)—GA 3.0° TCH 25'. Trees.
RWY 20: MALSR. PAPI(P2L)—GA 3.0° TCH 24'. Trees.
SERVICE: FUEL 100LL, JET A1+ LGT Actvt MALSR Rwy 20; REIL Rwy 02; PAPI Rwy 02 & 20; HIRL Rwy 02-20—CTAF.


AIRPORT REMARKS: Attended Mon-Sat 1300-2200Z, Sun 1700-2200Z. For svc after hrs contact 252-578-3774. Unattended New Years Day, Easter, Jul 4th, Thanksgiving, and Christmas. Birds on & invof arpt. Agriculture equip ocny adj to Rwy 02-20. 100LL and Jet-A fuel avbl 24 hrs self service w/ credit card.

AIRPORT MANAGER: 252-583-3492
WEATHER DATA SOURCES: AWOS-3PT 119.975 (252) 583-3446.
COMMUNICATIONS: CTAF/UNICOM 123.075

Ⓡ **WASHINGTON CENTER APP/DEP CON** 132.025
CLEARANCE DELIVERY PHONE: For CD ctc Washington ARTCC at 703-771-3587.

RADIO AIDS TO NAVIGATION: NOTAM FILE RDU.
TAR RIVER (VL) (H) VORTAC 117.8 TYI Chan 125 N35°58.60' W77°42.22' 014° 21.4 NM to fld. 73/5W.

VOR unusable:
 253°-257° byd 40 NM
 299°-318° byd 40 NM

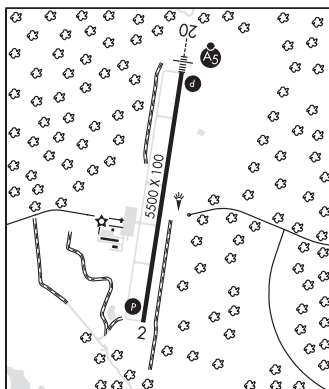

ROCKINGHAM

RICHMOND CO (RCZ)(KRCZ) 3 S UTC-5(-4DT) N34°53.48' W79°45.58'

CHARLOTTE
H-9C, 12H, L-25E, 35A, 36E
IAP

358 B NOTAM FILE RCZ
RWY 14-32: H5001X100 (ASPH) S-30 MIRL
RWY 14: PAPI(P2L)—GA 3.0° TCH 24'. Thld dsplcd 150'. Trees.
RWY 32: REIL. PAPI(P2L)—GA 3.0° TCH 40'. Thld dsplcd 201'. Railroad.
RWY 04-22: 3009X490 (TURF) 0.3% up SW
RWY 04: Trees.
RWY 22: Trees.


SERVICE: FUEL 100LL, JET A1+ LGT Actvt dusk-dawn. REIL Rwy 32; PAPI Rwy 14 and 32; MIRL Rwy 14-32—CTAF.
AIRPORT REMARKS: Attended Mon-Fri 1300-2200Z, unatndd Sat, Sun and Federal Hols. For arpt attendant nights and Sun call 910-997-5071. 100LL and Jet A—24hr self-service with credit card. Rwy 04-22 not in use when wet—turbine engine acft and acft over 10,000 lbs. Call 910-997-5071 for runway conditions before landing. Rwy 14 has 60' drop-off 350' from dsplcd thr all sides. Rwy 32 has numerous obstructions in apch including 5' fence, 12' road, and 20' railroad.

AIRPORT MANAGER: 910-206-0419
WEATHER DATA SOURCES: AWOS-3 118.775 (910) 997-4093.
COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ **FAYETTEVILLE APP/DEP CON** 127.8
CLEARANCE DELIVERY PHONE: For CD ctc Washington ARTCC at 703-771-3587.
RADIO AIDS TO NAVIGATION: NOTAM FILE RDU.

SANDHILLS (L) (L) VORTAC 111.8 SDZ Chan 55 N35°12.93' W79°35.28' 207° 21.2 NM to fld. 588/3W.

VOR unusable:
 075°-143°
 144°-154° blo 6,000'
 144°-154° byd 23 NM
 155°-179° blo 5,000'
 180°-264° blo 8,000'
 301°-019° byd 10 NM blo 10,000'
 DME unusable:
 041°-092° blo 3,000'
 TAC AZM unusable:
 016°-050° byd 28 NM blo 3,000'

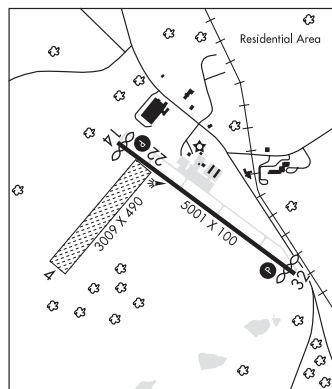

ROCKINGHAM CO HELIPORT (See EDEN on page 305)