

SUNLIGHT MOUNTAIN 5SM N39°25.53' W107°22.75'/10603
 AWOS-3 126.075 (970) 384-3380 AWOS visibility unreliable indef.

DENVER
 L-9E

TELLURIDE RGNL (TEX)(KTEX) 5 W UTC-7(-6DT) N37°57.23' W107°54.53'

DENVER
 H-3E, L-9E
 IAP, AD

9070 B TPA-10484(1414) ARFF Index-See Remarks NOTAM FILE TEX

RWY 09-27: H7111X100 (ASPH-GRVD) S-45, D-89 PCN 35 F/D/X/T

HIRL 0.4% up E

RWY 09: REIL. PAPI(P4L)-GA 3.55° TCH 46'. Thld dsplcd 200'. Rgt tfc.

RWY 27: REIL. PAPI(P4L)-GA 4.0° TCH 40'. Thld dsplcd 200'.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 09: TORA-7111 TODA-7111 ASDA-7111 LDA-6911

RWY 27: TORA-7111 TODA-7111 ASDA-7111 LDA-6911

ARRESTING GEAR/SYSTEM

RWY 09: EMAS

RWY 27: EMAS

SERVICE: FUEL 100LL, JET A OX 1, 2, 3, 4 LGT Rwy 27 PAPI lgts unusable byd 2.5 NM due to terrain. ACTIVATE HIRL Rwy 09-27, PAPI Rwy 09, and Rwy 27, REIL Rwy 09 and Rwy 27-CTAF. Arpt lighting system emerg use only 0400-1300Z†.

NOISE: Noise abatement procedures in effect. For more information ctc TEX customer svc 970-728-8600.

AIRPORT REMARKS: Attended Apr-Oct 1400-0400Z†, Nov-Mar

1400-0100Z†. Arpt CLOSED 0400-1300Z†. Rising terrain all

quadrants. Arpt on 1000' mesa, strong vertical turbulence in area of

mesa edge. Rwy 09-27 recommended tkf Rwy 27, land Rwy 09 and avoid populated areas. Rwy 09-27 grade -.08 on rwy ends, -1.3 to approximately midpoint then +.75. Glider, hang glider and helicopter ops on and invof arpt. ARFF Index rstd to FAR 139 design groups Al-CIII. Cold temperature airport. Altitude correction required at or below -18C. Air carrier ops during unattended hrs must notify TEX customer svc at 970-728-8603 24 hrs in advance for provision of adequate ARFF personnel. Ldg fee.

AIRPORT MANAGER: (970) 728-8601

WEATHER DATA SOURCES: AWOS-3 118.325 (970) 728-1534.

COMMUNICATIONS: CTAF/UNICOM 123.0

RCO 122.2 (DENVER RADIO)

Ⓡ DENVER CENTER APP/DEP CON 125.35

CLEARANCE DELIVERY PHONE: For CD contact Denver ARTCC at 303-651-4814. If una to ctc Denver ARTCC, ctc Denver radio.

RADIO AIDS TO NAVIGATION: NOTAM FILE DEN.

CONES (VL) (L) VOR/DME 116.95 ETL Chan 116(Y) N38°02.42' W108°15.51' 095° 17.4 NM to fld. 8460/12E. VOR/DME unmonitored.

VOR unusable:

042°-096° byd 40 NM

097°-141° byd 25 NM

142°-147° byd 40 NM

148°-178° byd 15 NM

179°-185° byd 40 NM

205°-226° byd 40 NM

280°-040° byd 40 NM

349°-021° byd 35 NM blo 16,000'

DME unusable:

077°-088° byd 30 NM


097°-141° byd 25 NM

148°-178° byd 15 NM

207°-220° byd 34 NM blo 14,000'

349°-021° byd 35 NM blo 16,000'

LDA/DME 109.3 I-TEX Chan 30 Rwy 09. LOC unusable byd 20° either side of course centerline; within 0.9 NM, 1.0 DME, from thld. DME unusable 20° left and right of course.

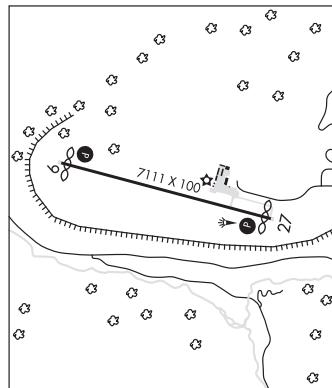

THURMAN N39°41.90' W103°12.90' NOTAM FILE DEN.

WICHITA
 H-5A, L-10G

(VL) (H) VORTACW 112.9 TXC Chan 76 208° 32.9 NM to Limon Muni. 4890/12E.

VOR unusable:

195°-224° byd 40 NM

225°-235° byd 40 NM blo 18,000'

236°-245° byd 40 NM

246°-256° byd 40 NM blo 8,500'

246°-256° byd 65 NM

257°-270° byd 40 NM blo 18,000'