
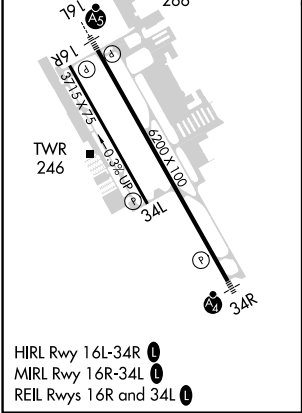


WAAS CH 56239 W34B	APP CRS 326°	Rwy Idg TDZE 182 Apt Elev 192
--	------------------------	---

RNAV (GPS) RWY 34L

MANASSAS RGNL/HARRY P DAVIS FLD (HEF)

▼ ▲ DME/DME RNP-0.3 NA. When local altimeter setting not received, use Washington Dulles Intl altimeter setting and increase all MDA 60 feet; increase LNAV Cat C/D and Circling Cat C and D visibility ¼ mile. Helicopter visibility reduction below ¾ SM NA.			MISSED APPROACH: Climbing left turn to 3000 direct CSN VORTAC and hold.		
ATIS 125.175	POTOMAC APP CON 128.525 306.925	MANASSAS TOWER ★ 133.1 (CTAF) 0 360.75	GND CON 121.8	CLNC DEL 120.2	CLNC DEL 120.2 (When twr closed)

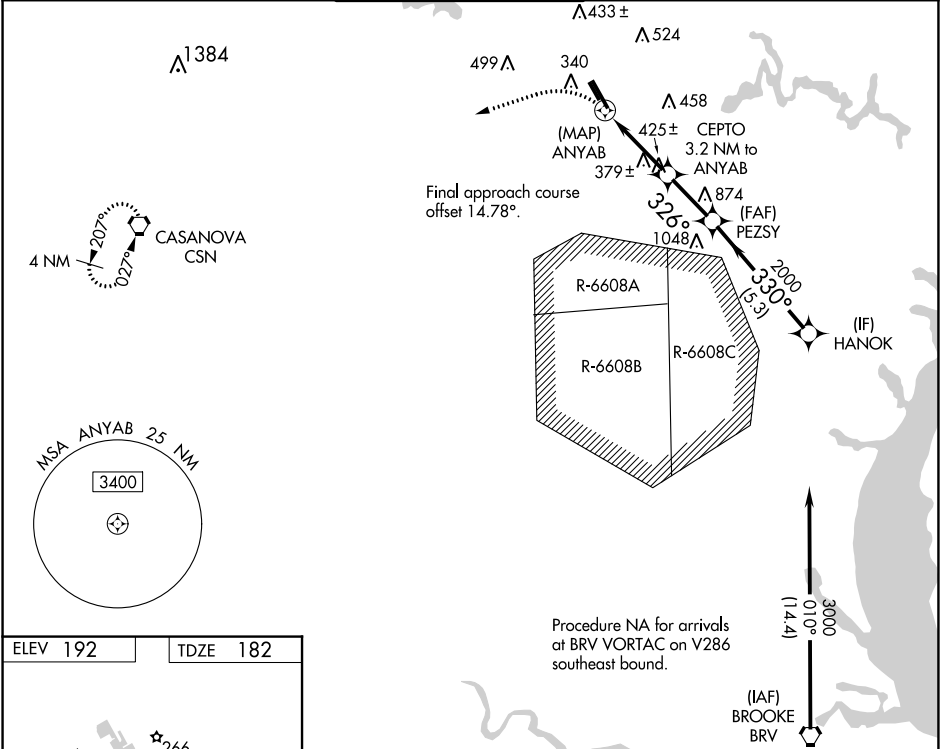

3000 CSN		VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 43).		HANOK	
0.9 NM to ANYAB		CEPTO 3.2 NM to ANYAB		330°	
ANYAB		PEZSY		2000	
1260		2.79°		TCH 40	
0.4		0.9		2.4 NM	
CATEGORY		A		B	
LP MDA		640-1		458 (500-1)	
LNAV MDA		680-1		498 (500-1)	
CIRCLING		720-1		740-1	
528 (600-1)		548 (600-1)		840-1¾	
				648 (700-1¾)	
				880-2¼	
				688 (700-2¼)	