


WAAS CH 65628 W33A	APP CRS 328°	Rwy Idg TDZE Apt Elev	6847 171 173
--	------------------------	-----------------------------	---


RNAV (GPS) RWY 33

BRADLEY INTL (BDL)

RNP APCH - GPS.		MALSF 	MISSED APPROACH: Climb to 3500 direct DOCEB and hold, continue climb-in-hold to 3500.		
	Inop table does not apply to LPV. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -17°C or above 54°C.				
D-ATIS 118.15	BRADLEY APP CON 123.95 290.55 (061°-240°) 125.35 281.5 (241°-060°)	BRADLEY TOWER 120.3 351.8	GND CON 121.9 348.6	CLNC DEL 121.75 322.3	CPDLC

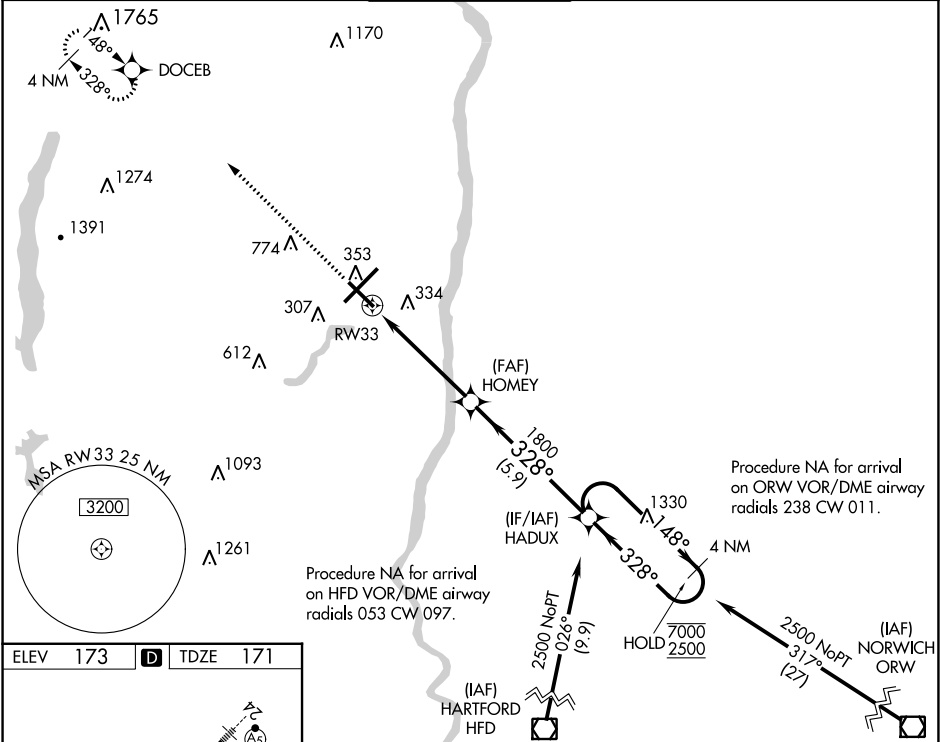

ELEV 173	D	TDZE 171
----------	----------	----------

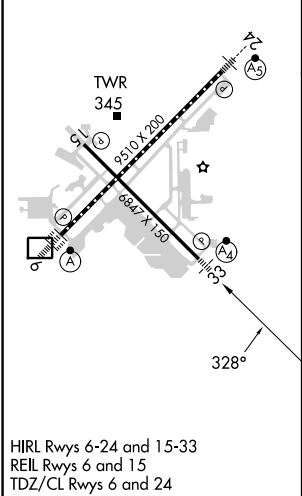

HIRL Rwy 6-24 and 15-33
REIL Rwy 6 and 15
TDZ/CL Rwy 6 and 24

3500 ↑	DOCEB ✦	VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 72).			4 NM Holding Pattern
GP 3.00° TCH 59					
CATEGORY	A	B	C	D	
LPV DA		371/40	200 (200-¾)		
LNAV/ VNAV	DA	463/40	292 (300-¾)		
LNAV MDA	560/40	389 (400-¾)	560/45	389 (400-¾)	
C CIRCLING	700-1	527 (600-1)	1120-2¾ 947 (1000-2¾)	1220-3 1047 (1100-3)	