


VORTAC LAL 116.0 Chan 107	APP CRS 256°	Rwy Idg 8500 TDZE 142 Apt Elev 142
---	------------------------	---

VOR RWY 28
LAKELAND LINDER INTL (LAL)

- ⚠ Circling NA to Rwys 8 and 26. Rwy 28 helicopter visibility reduction below 1 SM NA. Straight-in Rwy 28 NA at night, Circling Rwy 28 NA at night.
- MISSED APPROACH: Climb to 1000 then climbing right turn to 2000 on heading 017° and on LAL VORTAC R-330 to PLUMY INT/PIE 33.4 DME and hold.

ATIS 118.025	TAMPA APP CON 120.65 290.3	LAKELAND TOWER 124.5 236.775	GND CON 121.4
------------------------	--------------------------------------	--	-------------------------

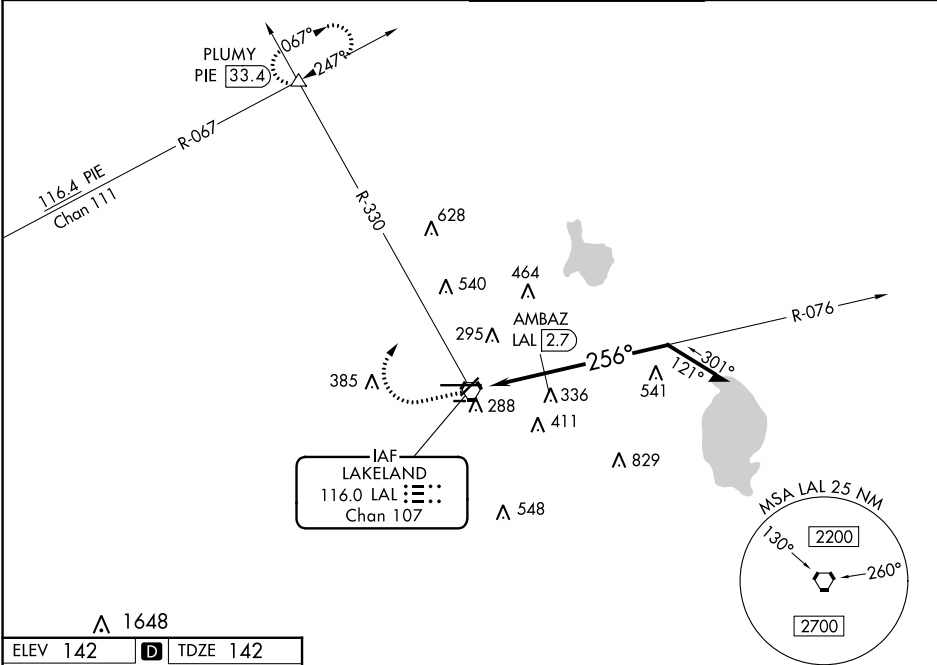

1000
↑

2000
hdg
017°

LAL
R-330

PLUMY
△

LAL
VORTAC

076°

Remain
within 10 NM

2000

256°

920

2.96°

TCH 45

2.7 NM

VGSI and descent angles not coincident
(VGSI Angle 3.00/TCH 71).

CATEGORY	A	B	C	D
S-28	920/55 778 (800-1)	920-1¼ 778 (800-1¼)	920-2½	778 (800-2½)
CIRCLING	920-1 778 (800-1)	920-1¼ 778 (800-1¼)	920-2½	778 (800-2½)

AMBBAZ FIX MINIMUMS

S-28	600/55	458 (500-1)	600-1⅜	458 (500-1⅜)
CIRCLING	600-1 458 (500-1)	660-1 518 (600-1)	720-1½ 578 (600-1½)	840-2¼ 698 (700-2¼)

TDZ/CL Rwy 10
HIRL Rwy 5-23 and 10-28