

YIGO, GUAM I, GUAM

TACAN Y RWY 24R


| | | |
|---|-------------------------|---|
| VORTAC UNZ 115.8 Chan T05 | APCH CRS 234° | Rwy ldg 10,528 TDZE 617 Arprt Elev 617 |
|---|-------------------------|---|

- (USAF)


ANDERSEN AFB (PGUA)

| | | |
|---|--------|---|
| RNAV or RADAR required for missed approach | ALSF-1 | MISSED APPROACH: Climb to 1100, then climbing left turn to intercept UNZ R-054 to MDBUG and hold. |
| <p>▼ * When ALS inop increase CAT AB RVR to 55, vis to 1 mile; CAT CDE RVR to 50, vis to 1 mile.</p> <p>** Circling not authorized NW of Rwy 06L-24R.</p> | | |

| | | | | |
|--------------------------------|--|-----------------------------|-------------------------------|----------------------------------|
| ATIS 118.175 254.325 | GUAM APP CON/DEP CON 119.8 269.0 | TOWER 126.2 233.7 | GND CON 121.7 275.8 | CLNC DEL 126.725 256.7 |
|--------------------------------|--|-----------------------------|-------------------------------|----------------------------------|

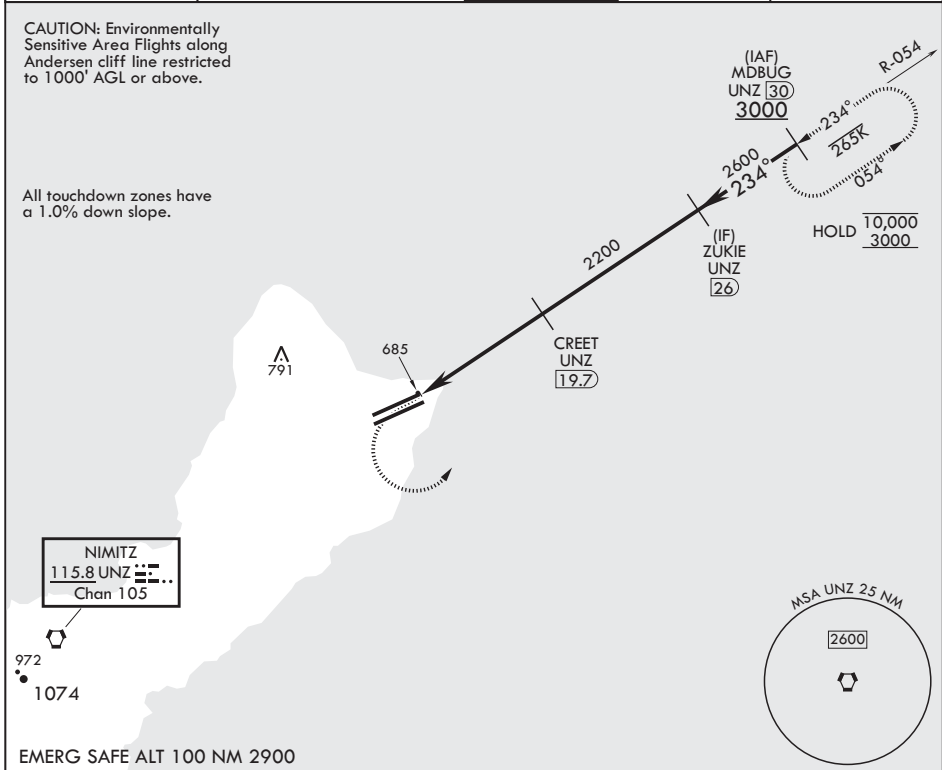

| | | | | |
|------|------|--------------|----------|----------|
| 1100 | 3000 | MDBUG UNZ 30 | ELEV 617 | TDZE 617 |
| | | | | |

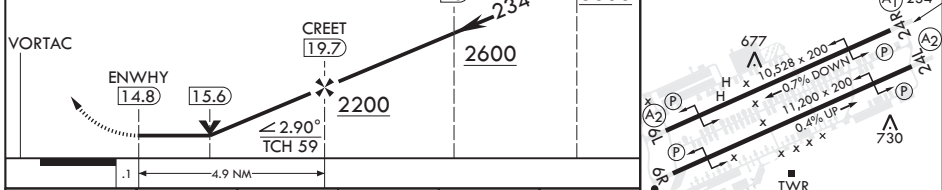

| CATEGORY | A | B | C | D | E |
|------------|--------------------|--------------------|----------------------|--------------------|----------------------|
| S-24R* | 940/24 323 (400-½) | | 940/40 323 (400-¾) | | |
| CIRCLING** | 1060-1 443 (500-1) | 1080-1 463 (500-1) | 1240-1¾ 623 (700-1¾) | 1240-2 623 (700-2) | 1240-2¼ 623 (700-2¼) |

YIGO, GUAM I, GUAM 13°35'N - 144°56'E ANDERSEN AFB (PGUA)

Amdt 3 10AUG23
TERPS

TACAN Y RWY 24R

PAC, 11 JUL 2024 to 05 SEP 2024

PAC, 11 JUL 2024 to 05 SEP 2024