
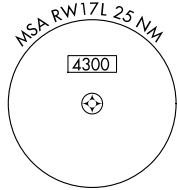


APP CRS	Rwy Idg	<b>8605</b>
<b>168°</b>	TDZE	<b>27</b>
	Apt Elev	<b>27</b>

# RNAV (RNP) Z RWY 17L

SACRAMENTO INTL (SMF)


<b>RNP AR APCH-GPS.</b> ▼ For uncompensated Baro-VNAV systems, procedure NA below -2°C or above 54°C. For inop ALS, increase RNP 0.12 all Cats visibility to RVR 4000; increase RNP 0.30 all Cats visibility to RVR 4500.		MALSR 	MISSED APPROACH: Climb to 500 then right turn to 3000 direct GRIME and hold. *Missed approach requires minimum climb of 290 feet per NM to 3000. #Missed approach requires minimum climb of 300 feet per NM to 3000.		
D-ATIS <b>126.75</b>	NORCAL APP CON <b>125.4 259.1 (W-NE) 125.25 257.9 (SW) 127.4 317.5 (E-SE)</b>	CAPITOL TOWER <b>125.7 256.7</b>	GND CON <b>121.7 256.7</b>	CLNC DEL <b>121.1 256.7</b>	CPDLC

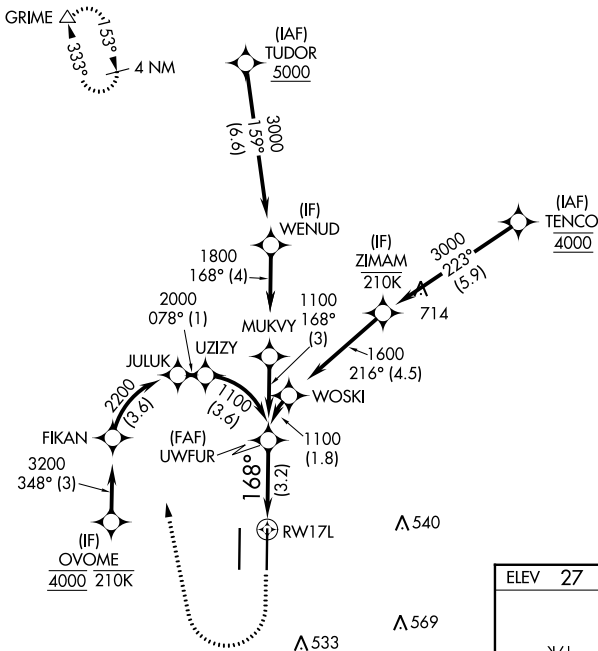

SW-2, 28 NOV 2024 to 26 DEC 2024

SW-2, 28 NOV 2024 to 26 DEC 2024

500 ↑	3000 ↷	GRIME △	VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 64).
----------	-----------	------------	---

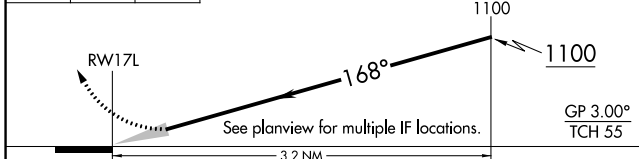

ELEV 27	<b>D</b> TDZE 27
---------	------------------

TDZ/CL Rwys 17L and 17R  
 HIRL Rwys 17R-35L and 17L-35R

CATEGORY	A	B	C	D
RNP 0.12 DA#		277/24	250 (300-½)	
RNP 0.30 DA*		339/24	312 (400-½)	

## AUTHORIZATION REQUIRED