


LOC I-DTO 109.1	APP CRS 177°	Rwy Idg 18L 18R TDZE 6502 5003 642 643 Apt Elev 643 643
---------------------------	------------------------	--

ILS or LOC RWY 18L



DENTON ENTERPRISE (D'TO)

ADF required. RADAR required for procedure entry.				MALSR AG	MISSED APPROACH: Climb to 2500 then right turn direct PINCK LOM and hold.
For inop ALS, increase S-ILS 18L cat C/D to 1/2 SM. For inop ALS, increase S-LOC 18L Cat C/D to 1/2 SM.					

ATIS 119.325	LONE STAR APP CON 118.1 306.95	DENTON TOWER* 119.95 (CTAF)	GND CON 123.95	CLNC DEL 123.95	UNICOM 122.95
------------------------	--	---------------------------------------	--------------------------	---------------------------	-------------------------

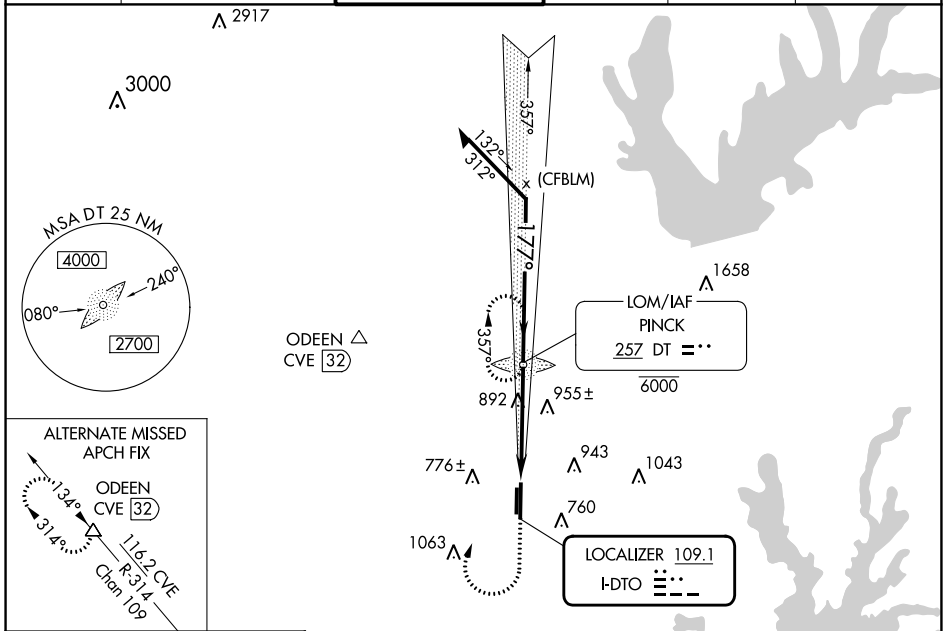

ELEV 643	D	TDZE 18L 642
177°		TDZE 18R 643

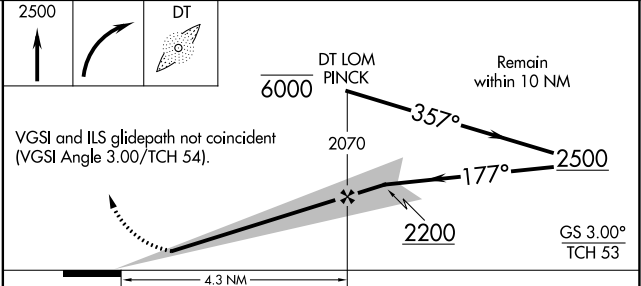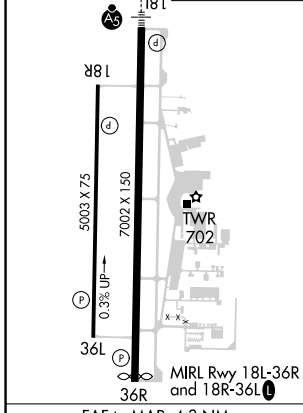

CATEGORY	A	B	C	D
S-ILS 18L	842-1/2		200 (200-1/2)	
S-LOC 18L	1160-1/2	518 (600-1/2)	1160-1	518 (600-1)
SIDESTEP 18R	1260-1	617 (700-1)	1260-1 3/4 617 (700-1 3/4)	1260-2 617 (700-2)
CIRCLING	1260-1	617 (700-1)	1380-2 737 (800-2)	1380-2 1/4 737 (800-2 1/4)

FAF to MAP 4.3 NM					
Knots	60	90	120	150	180
Min:Sec	4:18	2:52	2:09	1:43	1:26