


LOC/DME I-CMH 111.75 Chan 54 (Y)	APP CRS 281°	Rwy Idg 10113 TDZE 815 Apt Elev 815
--	------------------------	--



ILS or LOC RWY 28L

JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required.		MALSR	MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct BU LOM and hold.		
<p>∇ Simultaneous approach authorized.</p> <p>▲ For inop ALS, increase S-LOC 28L Cat C/D visibility to 1 3/8 SM.</p>					
D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC

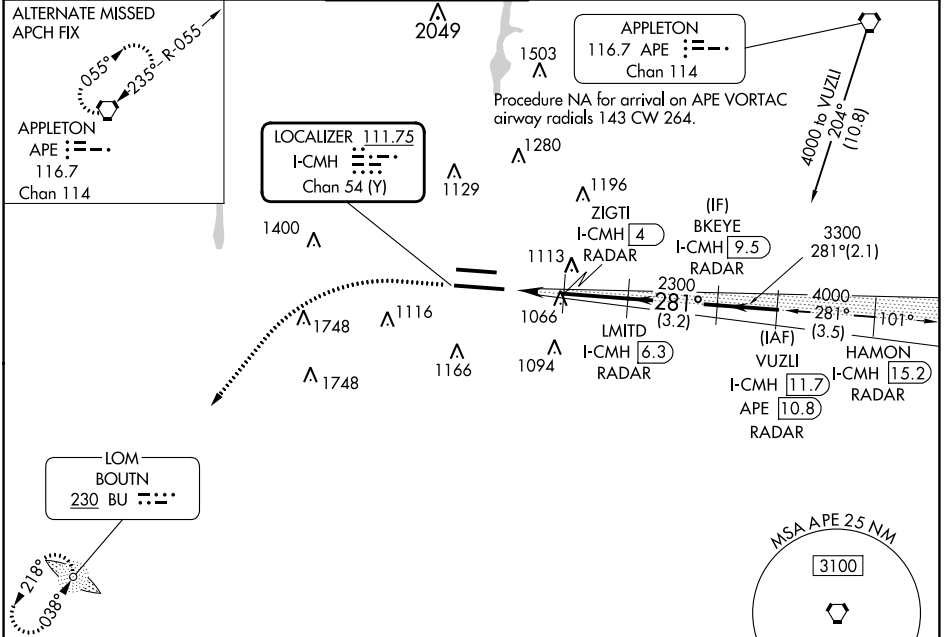

ELEV 815	D	TDZE 815
-----------------	----------	-----------------

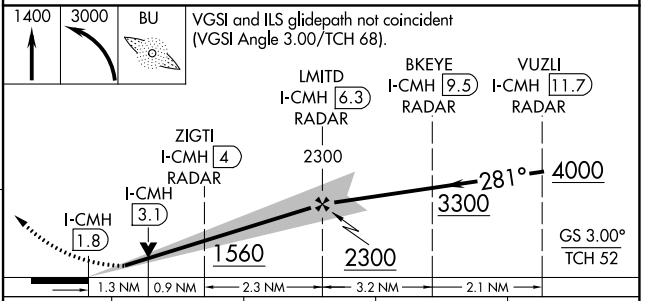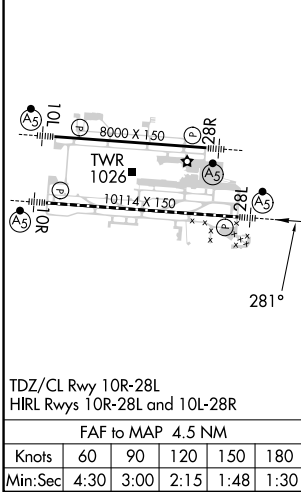

	1.3 NM	0.9 NM	2.3 NM	3.2 NM	2.1 NM
CATEGORY	A	B	C	D	
S-ILS 28L	1015/18 200 (200-1/2)				
S-LOC 28L	1300/24	485 (500-1/2)	1300/50	485 (500-1)	
<input checked="" type="checkbox"/> CIRCLING	1340-1	525 (600-1)	1520-2 705 (800-2)	1520-2 1/4 705 (800-2 1/4)	

EC-2, 26 DEC 2024 to 23 JAN 2025

EC-2, 26 DEC 2024 to 23 JAN 2025