

APP CRS 237°	Rwy Idg 5000
	TDZE 302
	Apt Elev 302

RNAV (GPS) RWY 24

WOODWARD FLD (CDN)


⚠ When local altimeter setting not received, use Columbia altimeter setting and increase all MDAs 100 feet; increase LNAV and Circling visibility Cats C/D 1/4 SM. DME/DME RNP-0.3 NA. Visibility reduction by helicopters NA.

MISSED APPROACH: Climbing left turn to 3000 direct IBAYE and hold.


AWOS-3PT
119.975

SHAW APP CON *
125.4 318.1


UNICOM
123.0 (CTAF) 0

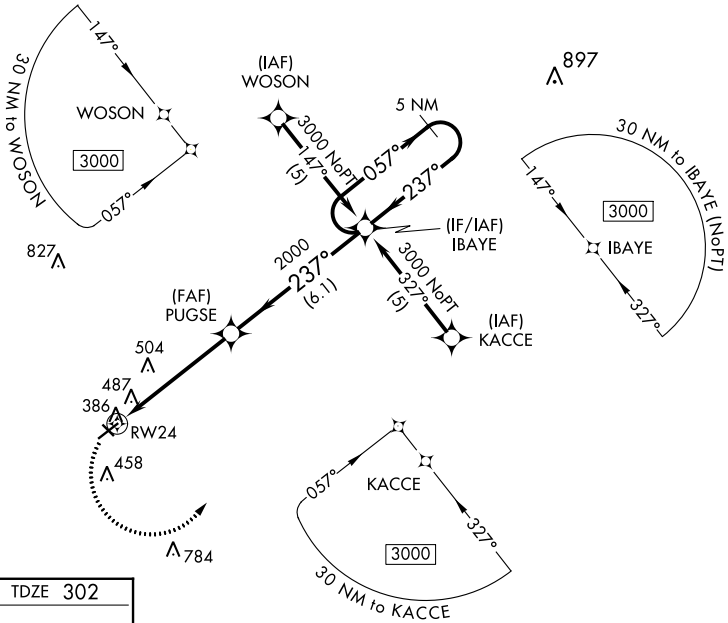

ELEV 302 TDZE 302

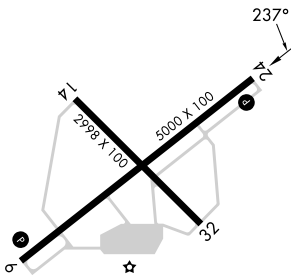

MIRL Rwy 6-24
REIL Rws 6 and 24

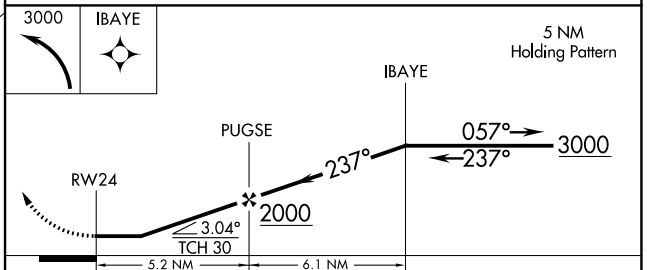

CATEGORY	A	B	C	D
LNAV MDA	800-1	498 (500-1)	800-1 1/4 498 (500-1 1/4)	800-1 1/2 498 (500-1 1/2)
CIRCLING	840-1	538 (600-1)	840-1 1/2 538 (600-1 1/2)	900-2 598 (600-2)