

WAAS CH 86735 W36A	APP CRS 001°	Rwy Idg TDZE 401 Apt Elev 402
--	------------------------	---



RNAV (GPS) RWY 36

OLIVE BRANCH/TAYLOR FLD (OLV)

▼ For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C (5°F) or above 54°C (130°F). DME/DME RNP-0.3 NA. When local altimeter setting not received, use Memphis Intl altimeter setting and increase all DA 32 feet and all MDA 40 feet; increase LPV and LNAV/VNAV all Cats and LNAV Cats C and D and Circling Cats C and D visibility ¼ mile. VDP and Baro-VNAV NA with Memphis Intl altimeter setting. Rwy 36 helicopter visibility reduction below ¾ SM NA.


▲ MISSED APPROACH: Climb to 1500 then climbing right turn to 2000 direct DOCAP and hold.

ATIS 119.925	MEMPHIS APP CON 125.8 338.3	OLIVE BRANCH TOWER ★ 125.275 (CTAF) 0	GND CON 121.2	CLNC DEL 121.2	CLNC DEL 121.3 (When twr closed)	UNICOM 122.95
------------------------	---------------------------------------	---	-------------------------	--------------------------	---	-------------------------

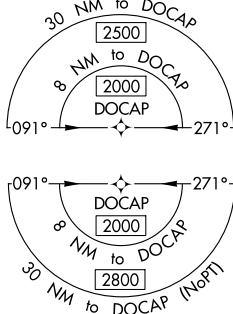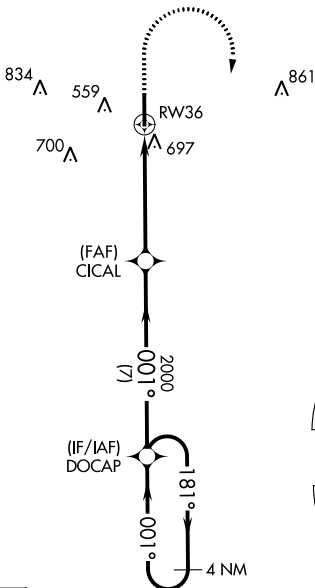

1061
▲

ELEV 402	TDZE 401
-----------------	-----------------

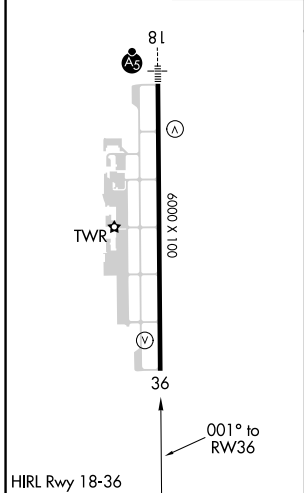

1500	2000	DOCAP	VGSi and RNAV glidepath not coincident (VGSi Angle 3.00/TCH 31).			
*LNAV only		*1.8 NM to RWY 36		4 NM Holding Pattern		
RWY 36		CICAL 2000	DOCAP		181° → 2000	
1.8 NM		3.1 NM		7 NM		
GP 3.00°	TCH 45					
CATEGORY	A	B	C	D		
LPV DA	709-1		308 (400-1)			
LNAV/VNAV DA	915-1¾		514 (600-1¾)			
LNAV MDA	1000-1	599 (600-1)		1000-1¾	599 (600-1¾)	
C CIRCLING	1060-1	658 (700-1)		1060-1¾	1200-2½ 798 (800-2½)	