


LOC/DME I-TLH <b>110.3</b> Chan 40	APP CRS <b>004°</b>	Rwy Idg <b>7000</b> TDZE <b>62</b> Apt Elev <b>83</b>
--	------------------------	---

# ILS Z or LOC Z RWY 36



TALLAHASSEE INTL (TLH)

DME required. RADAR required for procedure entry at CVILL.		MALSR	MISSED APPROACH: Climb to 4000 direct SZW VORTAC and hold, continue climb-in-hold to 4000.
* RVR 1800 authorized with use of FD or AP or HUD to DA.			
ASR			

ATIS <b>119.45 239.25</b>	TALLAHASSEE APP CON * <b>135.8 317.4</b>	TALLAHASSEE TOWER * <b>118.7(CTAF) 0 257.8</b>	GND CON <b>121.9 348.6</b>	CLNC DEL <b>126.65 275.8</b>	UNICOM <b>123.075</b>
------------------------------	---	---	-------------------------------	---------------------------------	--------------------------

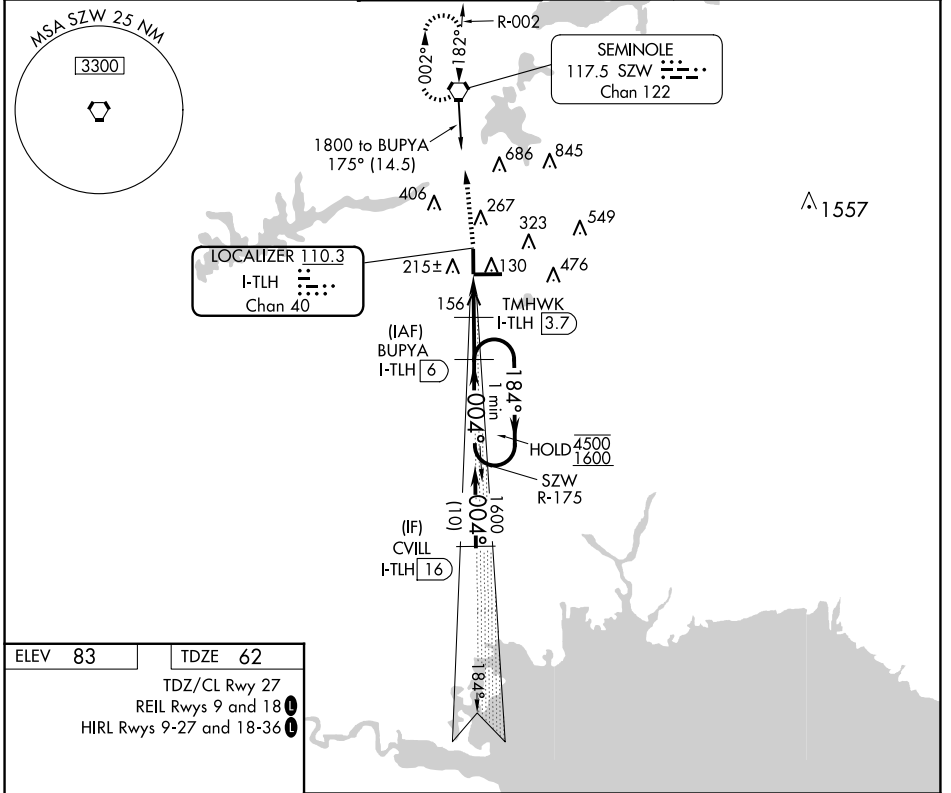

ELEV 83	TDZE 62
TDZ/CL Rwy 27	
REIL Rwy 9 and 18	
HIRL Rwy 9-27 and 18-36	

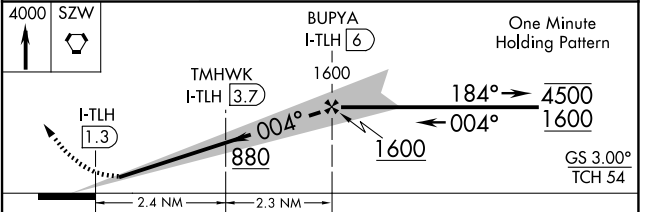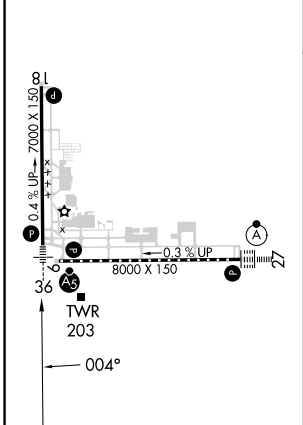

CATEGORY	A	B	C	D
S-ILS 36 *	262/24		200 (200-1/2)	
S-LOC 36	460/24	398 (400-1/2)	460/35	398 (400-5/8)
CIRCLING	580-1 497 (500-1)	600-1 517 (600-1)	640-1 1/2 557 (600-1 1/2)	800-2 1/4 717 (800-2 1/4)