

MARY ESTHER, FLORIDA

TACAN RWY 18

TACAN HRT Chan 45	APCH CRS 180°	Rwy Idg 9600 TDZE 35 Arpt Elev 38
-----------------------------	-------------------------	--

[USAF]


HURLBURT FLD (KHRT)

T * When ALS inop, increase CAT AB vis to 1 mile, CAT CD vis to 1¼ miles, and CAT E vis to 1½ miles.


SALSF

MISSED APPROACH: Climb to 1800 on R-172 to HAMBI/11 DME and hold.

ATIS	EGLIN APP CON		TOWER	GND CON
134.475 360.675	125.1	281.45 (271° - 089°)		
	132.1	360.6 (090° - 270°)	126.5 351.675	123.975 275.8

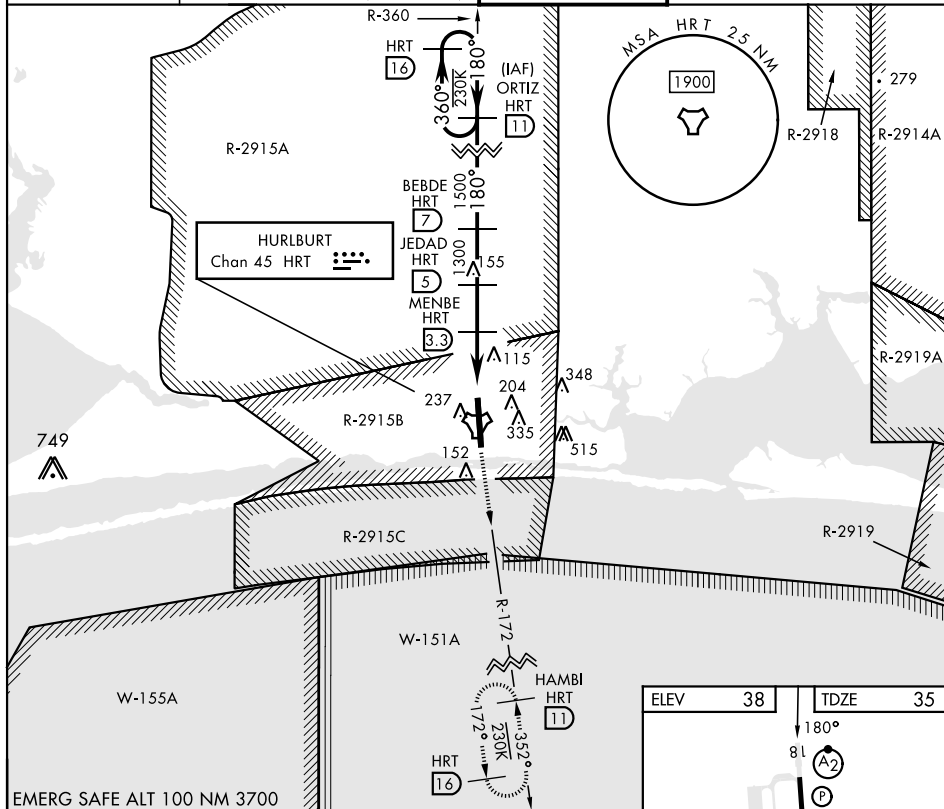


EMERG SAFE ALT 100 NM 3700

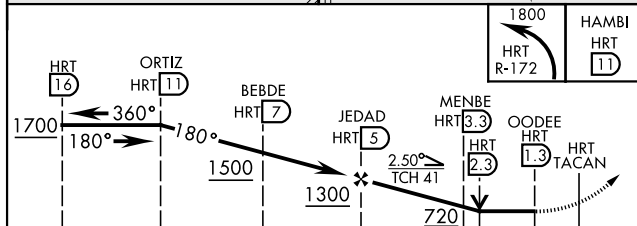

CATEGORY	A	B	C	D	E
S-18 *	460- $\frac{3}{4}$ 425 (500- $\frac{3}{4}$)		460-1 425 (500-1)		460-1 $\frac{1}{4}$ 425 (500-1 $\frac{1}{4}$)
C CIRCLING	640-1 602 (700-1)		640-1 $\frac{3}{4}$ 602 (700- $\frac{3}{4}$)	640-2 602 (700-2)	880-3 842 (900-3)

HIRL Rwy 18-36

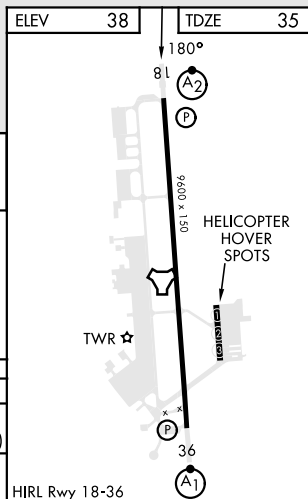

SE-3, 17 APR 2025 to 15 MAY 2025

MARY ESTHER, FLORIDA

30°26'N-86°41'W

HURLBURT FLD (KHRT)

Amdt 2 25JAN24

TACAN RWY 18