

HARLINGEN, TEXAS

AL-827 (FAA)

24249

APP CRS	Rwy Idg	7257
313°	TDZE	36
	Apt Elev	36

Rwy Idg	7257
TDZE	36
Apt Elev	36

IDZE	36
Apt Elev	36

Apt Elev **36**RNAV (RNP) Z RWY 31
VALLEY INTL (HRL)

VALLEY INTL (HRL)

RNP AR APCH - GPS.

V For uncompensated Baro-VNAV systems, procedure NA below -1°C or above 54°C . For inop ALS, increase RNP 0.11 all Cats visibilities to $\frac{3}{4}$ SM and increase RNP 0.30 all Cats visibilities $\frac{5}{8}$ SM. When local altimeter setting not received, procedure NA.

MALSR




MISSED APPROACH:
Climb to 2000 direct
CAKOB and hold.

ATIS
124.85


VALLEY APP CON
120.7 279.5

HARLINGEN TOWER ★
119.3 (CTAF) **L** 317.6

GND CON
121.7

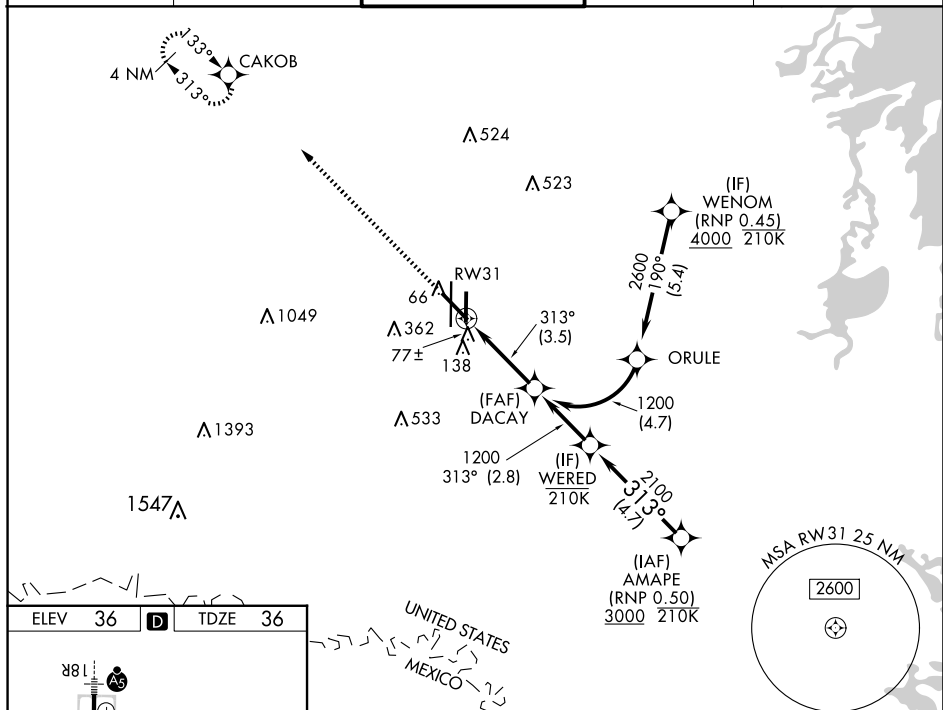UNICOM
122.95

SC-3, 17 APR 2025 to 15 MAY 2025

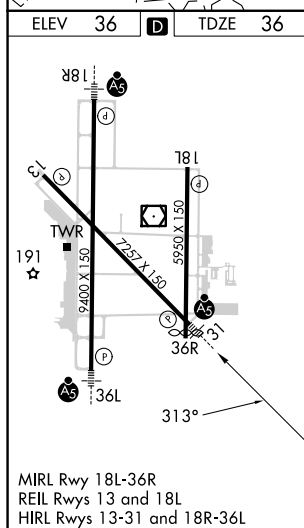

See Planview for multiple IF locations.

DACY
1200

1200

RW31

313°

GP 3.00°
TCH 55

3.5 NM

CATEGORY	A	B	C	D
RNP 0.11 DA		286-1/2	250 (300-1/2)	
RNP 0.30 DA		339-1/2	303 (400-1/2)	

AUTHORIZATION REQUIRED

HARLINGEN, TEXAS
Amdt 2 11JUL24

26°14'N-97°39'W

VALLEY INTL (HRL)

RNAV (RNP) Z RWY 31