

YIGO, GUAM I, GUAM

TACAN Z RWY 24R

TACAN UAM Chan 54	APCH CRS 231°	Rwy Idg 10,528 TDZE 617 Arpt Elev 617
-----------------------------	-------------------------	--

- (USAF)

ANDERSEN AFB (PGUA)

	RADAR or DME required.
--	------------------------

T * When ALS inop, increase CAT AB RVR to 55, vis to 1 mile; CAT CDE RVR to 50, vis to 1 mile.
** Circling not authorized NW of Rwy 06L-24R.

ALSF-1


 

MISSED APPROACH: Climb to 1100, then climbing left turn to 3000 to intercept UAM R-051 to FOVEM and hold.

ATIS 118.175 254.325	GUAM APP CON/DEP CON 119.8 269.0	TOWER 126.2 233.7	GND CON 121.7 275.8	CLNC DEL 126.725 256.7
-------------------------	-------------------------------------	----------------------	------------------------	---------------------------


CAUTION: Environmentally Sensitive Area Flights along Andersen cliff line restricted to 1000' AGL or above.

All touchdown zones have a 1.0% down slope.

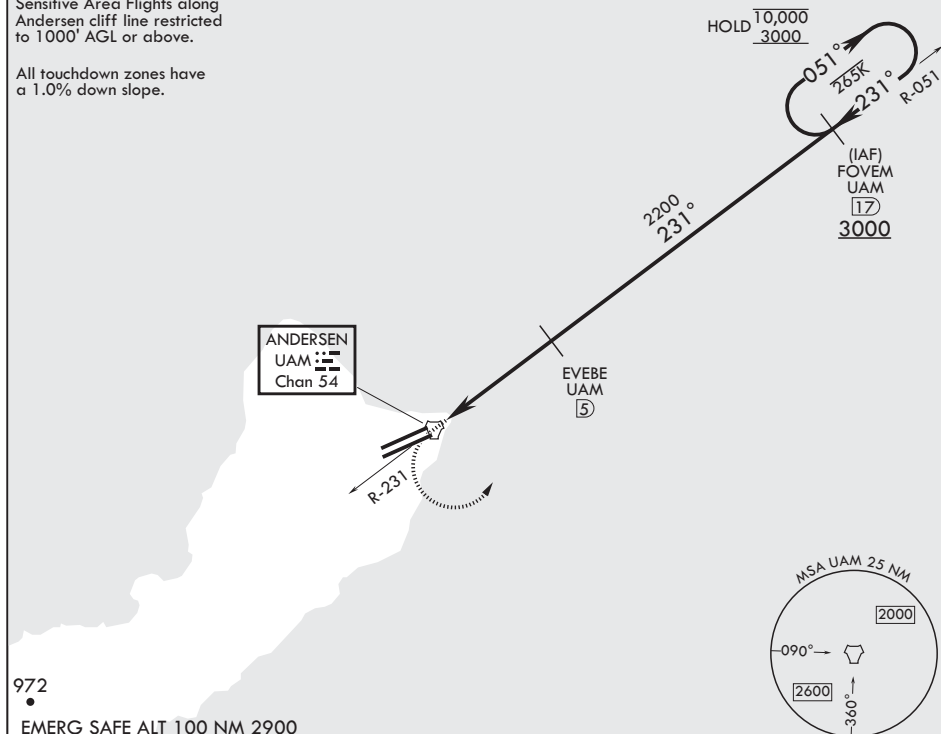

972

EMERG SAFE ALT 100 NM 2900

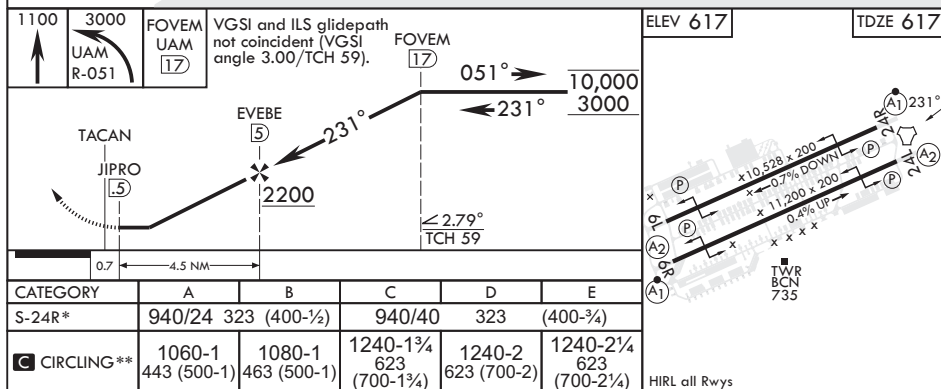

YIGO, GUAM I, GUAM

13°35'N - 144°56'E

ANDERSEN AFB (PGUA)

Amdt 2 17JUN21
TERPS

TACAN Z RWY 24R