

VORTAC MHZ	APP CRS	Rwy Idg	8500
113.2	349°	TDZE	346
Chan 79		Apt Elev	346

VOR/DME or TACAN RWY 34R



JACKSON-MEDGAR WILEY EVERS INTL (JAN)

⚠ When local altimeter setting not received, use Hawkins Fld altimeter setting and increase all MDA 20 feet; increase S-34R Cats C/D/E visibility 1/8 mile.

⚠ Circling NA for Cat E southwest of Rwy 16R-34L. Helicopter visibility reduction below 3/4 SM NA.

MISSED APPROACH: Climbing right turn to 3000 on heading 120° and MHZ VORTAC R-134 to RAKIN INT/ MHZ 16.5 DME and hold.

ATIS 121.05	JACKSON APP CON★ 123.9 317.7	JACKSON TOWER★ 120.9 (CTAF) 0 352.0	GND CON 121.7 348.6	UNICOM 122.95
----------------	---------------------------------	--	------------------------	------------------

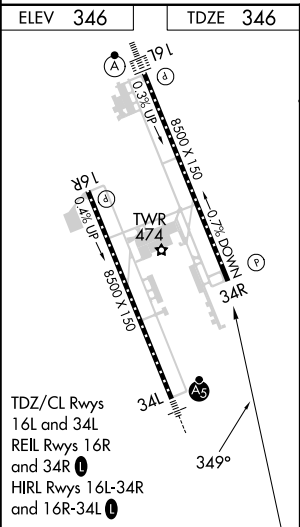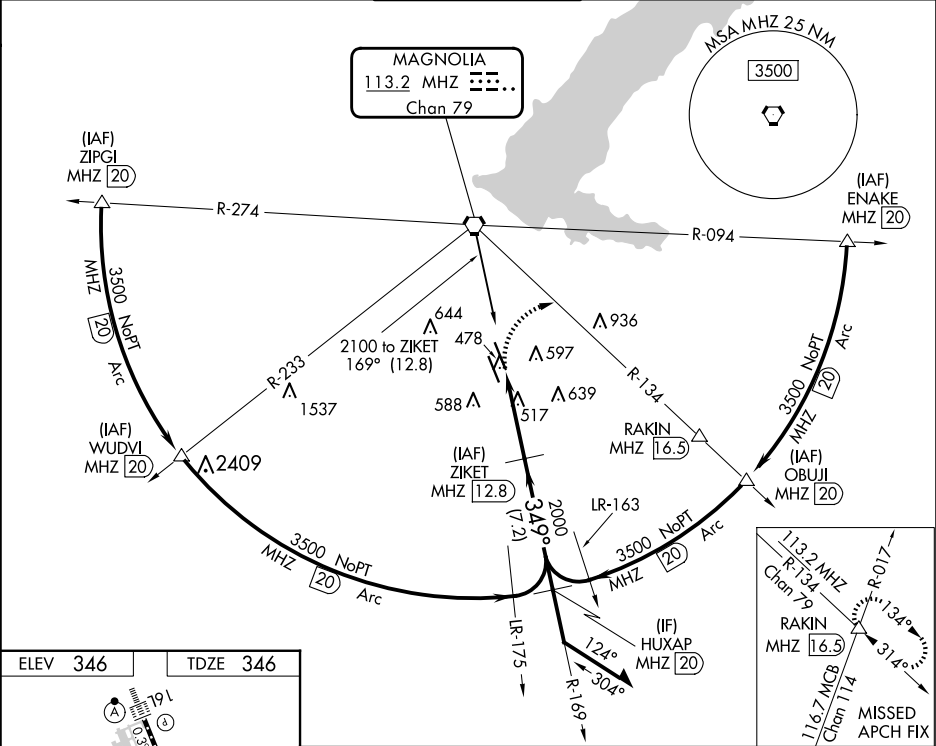

3000	MHZ R-134	RAKIN	ZIKET MHZ 12.8			Remain within 15 NM		
hdg 120°		△	169° 2100					
			349° 2000					
			2.99° TCH 66					
			5 NM					
CATEGORY	A	B	C	D	E			
S-34R	920/55	574 (600-1)	920-1½	574 (600-1½)				
CIRCLING	920-1	574 (600-1)	920-1½	960-2	1040-2½			
			574 (600-1½)	614 (700-2)	694 (700-2½)			