

CLEVELAND, OHIO

AL-84 (FAA)

24305

APP CRS 238°	Rwy Idg TDZE Apt Elev	9000 780 799
------------------------	-----------------------------	---

RNAV (RNP) Z RWY 24R

CLEVELAND-HOPKINS INTL (CLE)

RNP AR APCH.

T For uncompensated Baro-VNAV systems, procedure NA below -18°C (0°F) or above 54°C (130°F). For inop ALS, increase RNP 0.13 all Cats visibility to RVR 4500.

ALSF-2



MISSED APPROACH: Climb to 3000 direct ZAPAN and on track 274° to DJB VOR/DME and hold.


D-ATIS	CLEVELAND APP CON	CLEVELAND TOWER	GND CON	CLNC DEL	CPDLC
ARR 127.85	126.55 346.325	124.5 273.45	121.7 273.45	125.05 273.45	
DEP 132.375					

MISSED APCH FIX


DRYER
DJB



4 NM

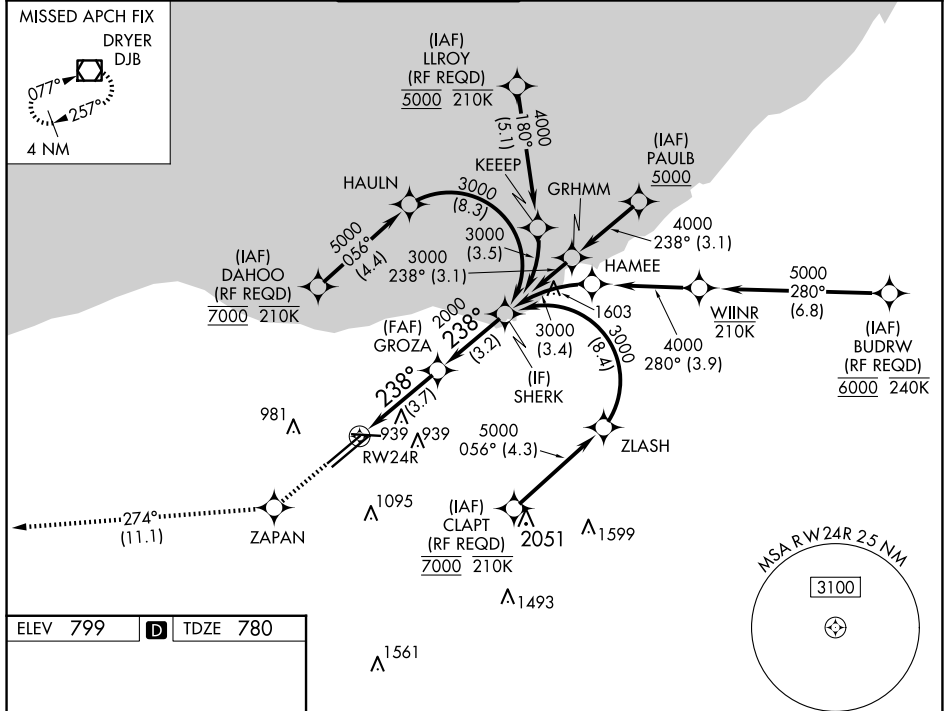

ELEV 799	D	TDZE 780
----------	----------	----------

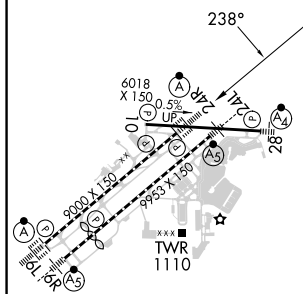

REF: Rwy 10

TDZ/CL Rwy 6L, 6R, 24L and 24R

HURL Rwys 6R-24L, and 6L-24R, 10-28

3000 ↑	ZAPAN ✦	tr 274°	DJB ☐	VGSI and RNAV glidepath not coincident (VGSI Angle 3.00°/TCH 65).	
				SHERK 3000 238° 2000 2000 GP 3.00° TCH 55	
CATEGORY	A		B	C	D
RNP 0.13 DA	1064/24		284 (300-½)		
RNP 0.30 DA	1176/35		396 (400-¾)		

AUTHORIZATION REQUIRED

CLEVELAND, OHIO

Orig 24MAY18

CLEVELAND-HOPKINS INTL (CLE)

41°25'N-81°51'W

RNAV (RNP) Z RWY 24R

EC-2, 12 JUN 2025 to 10 JUL 2025