


LOC I-DQG 111.7	APP CRS 003°	Rwy Ldg 10000 TDZE 707 Apt Elev 748	ILS RWY 36C (CAT II & III) CHARLOTTE/DOUGLAS INTL (CLT)
---------------------------	------------------------	--	---

RADAR required for procedure entry. DME or RADAR required.		ALSF-2	MISSED APPROACH: Climb to 3000 on CLT VOR/DME R-001 to TOMME/CLT 15.4 DME and hold.
Simultaneous approach authorized. DQG ILS ILZ Rwy 36C unusable for rollout guidance.			
D-ATIS 121.15	CHARLOTTE APP CON 128.325 (001°-119°) 257.2 (180°-359°) 120.05 (120°-295°) 307.8 (360°-179°) 134.75 (296°-360°)	CHARLOTTE TOWER 118.1 257.8 (Rwys 18L-36R) 126.4 257.8 (Rwy 18C-36C) 133.35 257.8 (Rwy 18R-36L)	GND CON 121.8 348.6 (W) 121.9 348.6 (E)

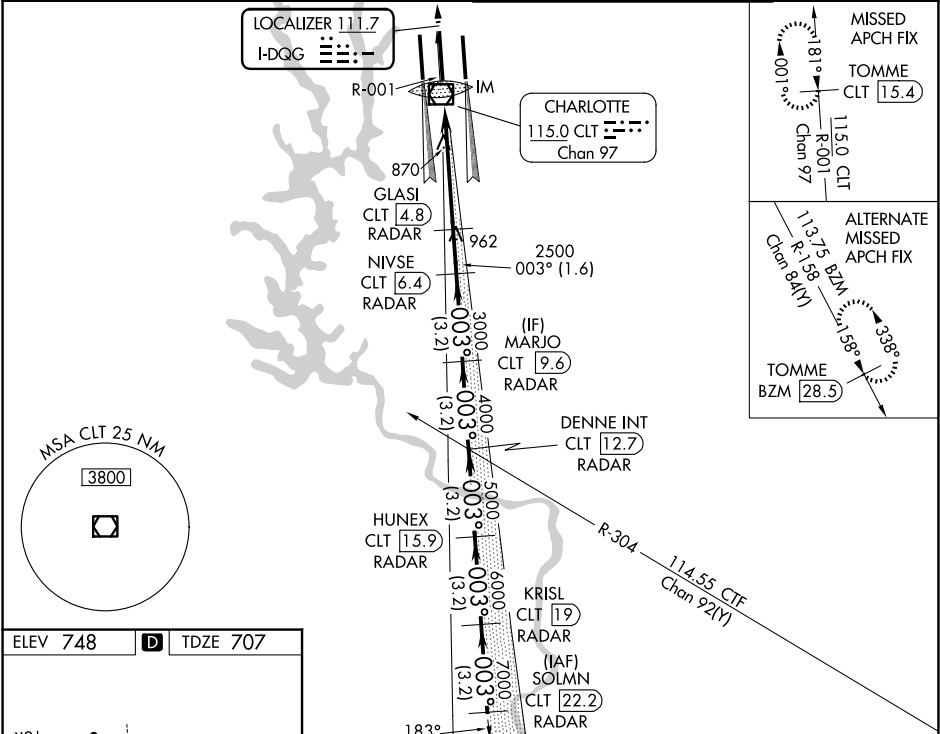

ELEV 748	D	TDZE 707
CATEGORY II & III ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED		