
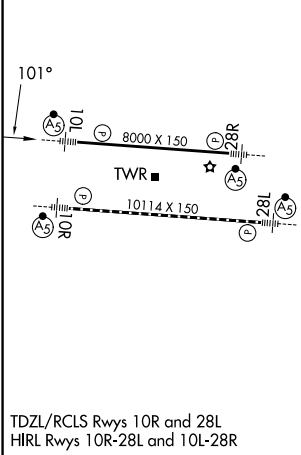


APP CRS	Rwy Ldg	8000
101°	TDZE	815
	Apt Elev	815

RNAV (RNP) Z RWY 10L
JOHN GLENN COLUMBUS INTL (CMH)

RNP AR APCH - GPS.	MALSR	MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct APE VORTAC and hold.
Simultaneous approach authorized. For uncompensated Baro-VNAV systems, procedure NA below -14°C or above 54°C. For inop ALS, increase RNP 0.30 all Cats visibility to RVR 6000.		

D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6
-----------------	------------------------------------	-------------------------------	------------------------

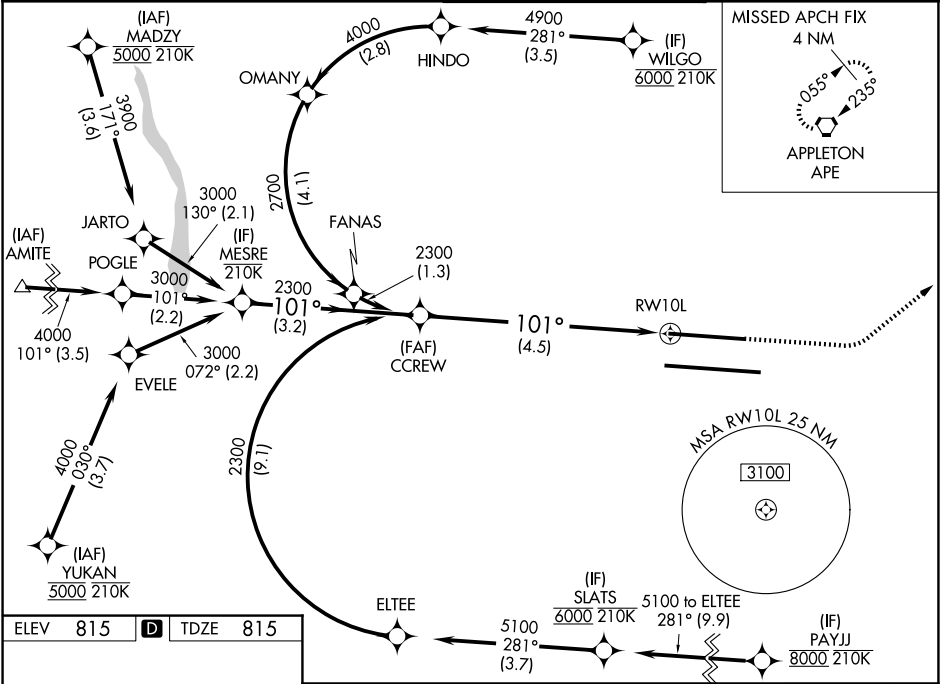

		1400	3000	APE
GP 3.00° TCH 51		See planview for multiple IF locations.		
2300		RWY10L		
4.5 NM				
CATEGORY	A	B	C	D
RNP 0.13 DA	1148/26 333 (400-½)			
RNP 0.26 DA	1198/35 383 (400-¾)			
RNP 0.30 DA	1216/40 401 (500-¾)			
AUTHORIZATION REQUIRED				