

HI-TACAN Z RWY 26

TACAN GSB Chan 112	APCH CRS 261°	Rwy Ldg 11,760 TDZE 109 Arprt Elev 109
------------------------------	-------------------------	---

[USAF]


SEYMOUR JOHNSON AFB (KGSB)

▼ * When ALS inop, increase vis to 1¼ miles.
** Circling N of Rwy 8-26 not authorized.





MISSED APPROACH: Climb to 2200 via GSB R-261 to TULME and hold.


ATIS ★ 317.625	APP CON 123.7 290.9 (258°-110°) 119.7 273.6 (111°-257°)	TOWER ★ 126.25 370.875	GND CON 132.45 275.8	CLNC DEL 128.025 270.8
--------------------------	---	----------------------------------	--------------------------------	----------------------------------

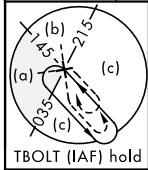



397

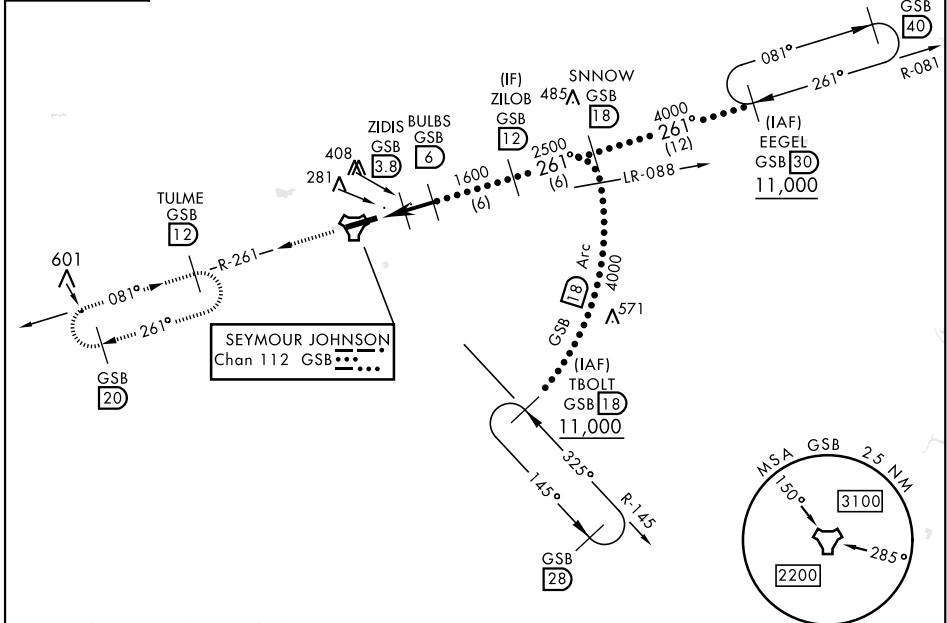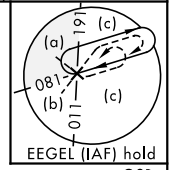

EMERG SAFE ALT 100 NM 3700



ELEV 109	TDZE 109
----------	----------

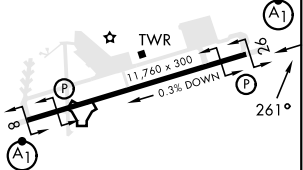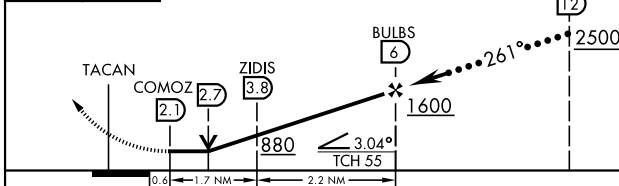

CATEGORY	C	D	E
S-26*	540/40	431 (500-¾)	
** CIRCLING	680-1½ 571 (600-1½)	740-2 631 (700-2)	740-2¼ 631 (700-2¼)

HIRL Rwy 8-26

HI-TACAN Z RWY 26