


GOLDSBORO, NORTH CAROLINA

TACAN Y RWY 8

TACAN GSB Chan 112	APCH CRS 081°	Rwy Idg 11,760 TDZE 73 Arpt Elev 109	[USAF]	SEYMOUR JOHNSON AFB (KGSB)
* When ALS inop, increase CAT AB RVR to 55, vis to 1 mile, CAT CDE vis to 1 3/8 miles. ** Circling N of Rwy 8-26 not authorized.			ALSF-1 A1	MISSED APPROACH: Climb to 2300 via GSB R-081 to ZILOB and hold.
ATIS ★ 317.625	APP CON 123.7 290.9 (258°-110°) 119.7 273.6 (111°-257°)	TOWER ★ 126.25 370.875	GND CON 132.45 275.8	CLNC DEL 128.025 270.8

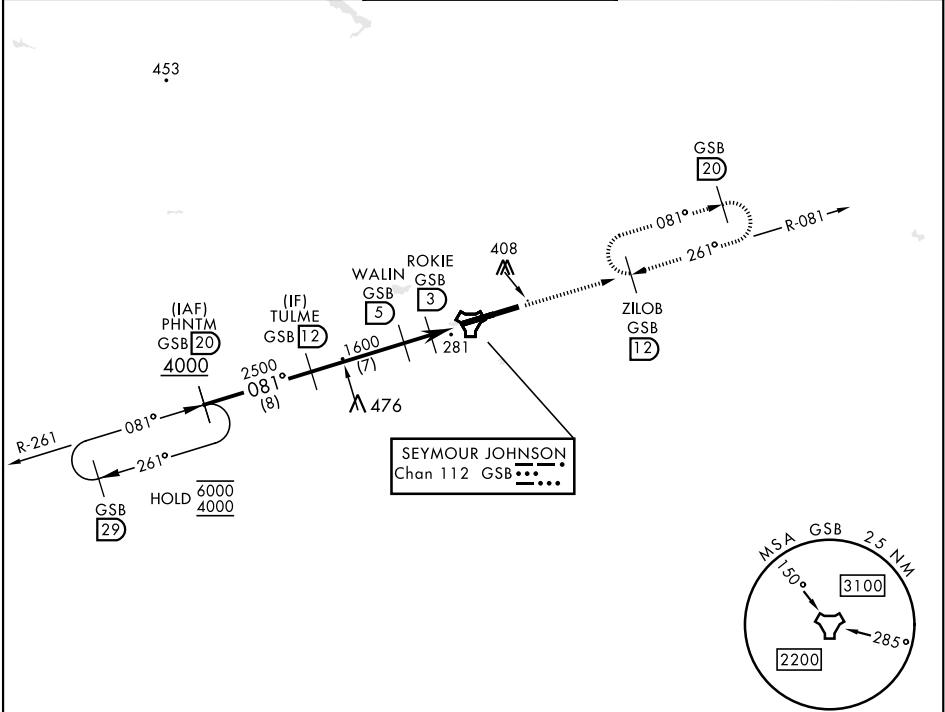

EMERG SAFE ALT 100 NM 3700

TULME 12 2500		WALIN 5 1600		ROKIE 3 960		TACAN	
↑ 3.01° TCH 55		↑ WALIN to ZESIX		2300 GSB R-081		ZILOB R-081 12	
2 NM		2.1 NM		0.3		TWR	
CATEGORY	A	B	C	D	E		
S-8 *	540/24	467 (500-1/2)	540/50	467 (500-1)			
CIRCLING **	580-1 471 (500-1)	600-1 491 (500-1)	680-1 1/2 571 (600-1 1/2)	740-2 631 (700-2)	740-2 1/4 631 (700-2 1/4)		

GOLDSBORO, NORTH CAROLINA

35°20'N-77°58'W

SEYMOUR JOHNSON AFB (KGSB)

Amtd 8 03NOV22

TACAN Y RWY 8

SE-2, 27 NOV 2025 to 25 DEC 2025

SE-2, 27 NOV 2025 to 25 DEC 2025