

WAAS CH 72603 W05A	APP CRS 047°	Rwy Ldg TDZE Apt Elev	8000 956 956
--	------------------------	-----------------------------	---

RNAV (GPS) RWY 5

DONALDSON FLD (GYH)


RNP APCH - GPS.

Baro-VNAV and VDP NA when using Greer altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 54°C. When local altimeter setting not received, use Greer altimeter setting and increase LPV DA to 1185 feet; increase LNAV/VNAV DA to 1279; increase all MDAs 40 feet and LNAV visibility Cats C and D ½ SM. For inop ALS, increase LNAV/VNAV visibility all Cats to ¾ SM and increase LNAV visibility Cats C/D to 1 ½ SM.

MALSR

MISSED APPROACH:
Climb to 3000 direct ILEYO and hold.

ATIS 127.325	GREER APP CON★ 118.8 270.275	DONALDSON TOWER★ 133.325 (CTAF) 0 269.25	GND CON 121.4	UNICOM 122.7
------------------------	--	--	-------------------------	------------------------

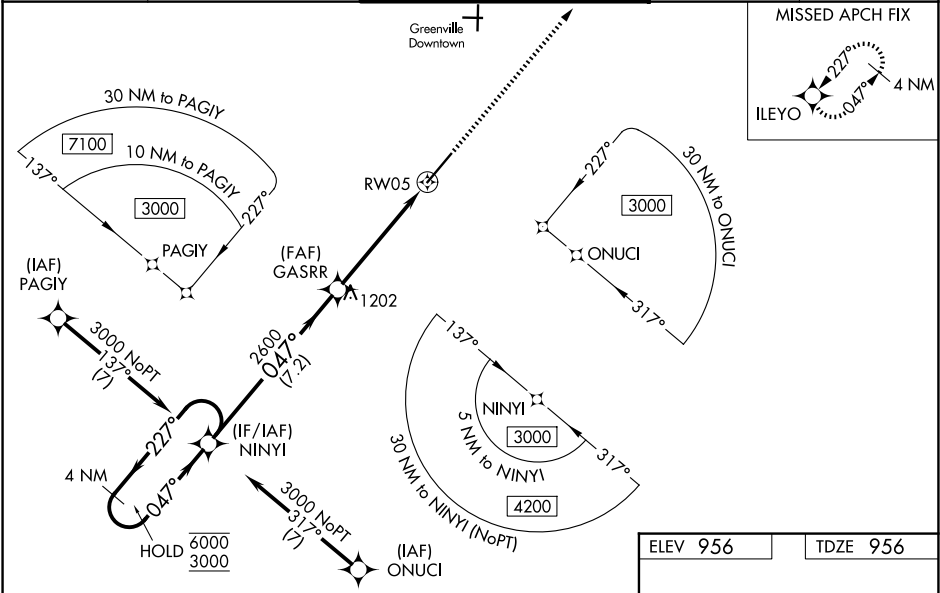

4 NM Holding Pattern NINYI

VGSI and RNAV glidepath not coincident (VGSI Angle 3.22/TCH 56).

3000 ILEYO

GP 3.00° TCH 52

6000 3000 227° 047°

2600 GASRR 2600

1 NM to RW05 RW05

7.2 NM 4 NM 1 NM

CATEGORY	A	B	C	D
LPV DA		1156-½ 200 (200-½)		
LNAV/VNAV DA		1250-½ 294 (300-½)		
LNAV MDA	1360-½ 404 (500-½)		1360-¾ 404 (500-¾)	
CIRCLING	1420-1 464 (500-1)	1480-1 524 (600-1)	1480-1½ 524 (600-½)	1520-2 564 (600-2)

0.3% DOWN 8000 X 150 0.4% UP

TWR

HIRL Rwy 5-23