

LOC I-BNE 110.7	APP CRS 337°	Rwy Ldg TDZE 161 Apt Elev 168
---------------------------	------------------------	---




ILS RWY 34 (CAT II & III)
RICHMOND INTL (RIC)

▼ DME from RIC VORTAC. DME use requires simultaneous reception of I-BNE and RIC DME. CAT II: RVR 1000 authorized with specific OPSPEC, MSPEC, or LOA approval and use of autoland or HUD to touchdown.


ALSF-2

MISSED APPROACH: Climb to 800 then climbing right turn to 2000 on RIC VORTAC R-018 to EPICS INT/ RIC 17.3 DME and hold.

ATIS 119.15 263.025	POTOMAC APP CON 126.4 282.375 (001°-185°) 126.75 307.2 (186°-360°)	RICHMOND TOWER 121.1 257.8	GND CON 121.9 348.6
-------------------------------	--	--------------------------------------	-------------------------------

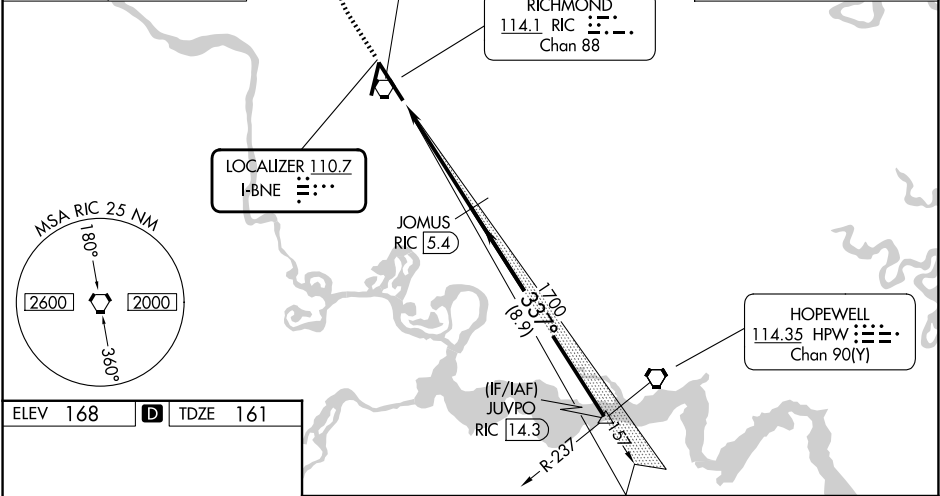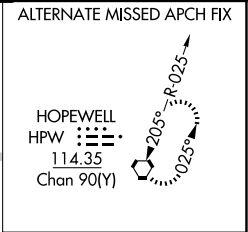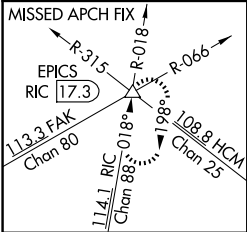

ELEV 168	D	TDZE 161
-----------------	----------	-----------------

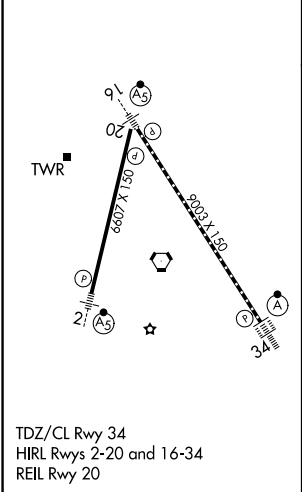

800	2000	EPICS	JOMUS RIC 5.4	JUVPO RIC 14.3
↑	RIC R-018	△	1700	1700
VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 79).				
GS 3.00° TCH 54				
4.7 NM				
8.9 NM				
CATEGORY	A	B	C	D
S-ILS 34	CAT II RA 101/12 100 DA 261			
S-ILS 34	CAT III RVR 07			

CATEGORY II & III ILS-SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

NE-3, 27 NOV 2025 to 25 DEC 2025

NE-3, 27 NOV 2025 to 25 DEC 2025