

APP CRS

023°

Rwy Ldg

6607

TDZE

161

Apt Elev

168

RNAV (RNP) Y RWY 2

RICHMOND INTL (RIC)

RNP AR APCH.


▼ For uncompensated Baro-VNAV systems, procedure NA below -11°C (13°F) or above 54°C (130°F). Rwy 2 helicopter visibility reduction below ¾ SM NA. For inop ALS, increase RNP 0.11 all Cats visibility to 1 SM and RNP 0.3 all Cats visibility to 1¼ SM.

MALSR

MISSED APPROACH:

Climb to 2100 on track 023° to IMASE and hold.

ATIS	POTOMAC APP CON	RICHMOND TOWER	GND CON
119.15 263.025	126.4 282.375 (001°-185°) 126.75 307.2 (186°-360°)	121.1 257.8	121.9 348.6

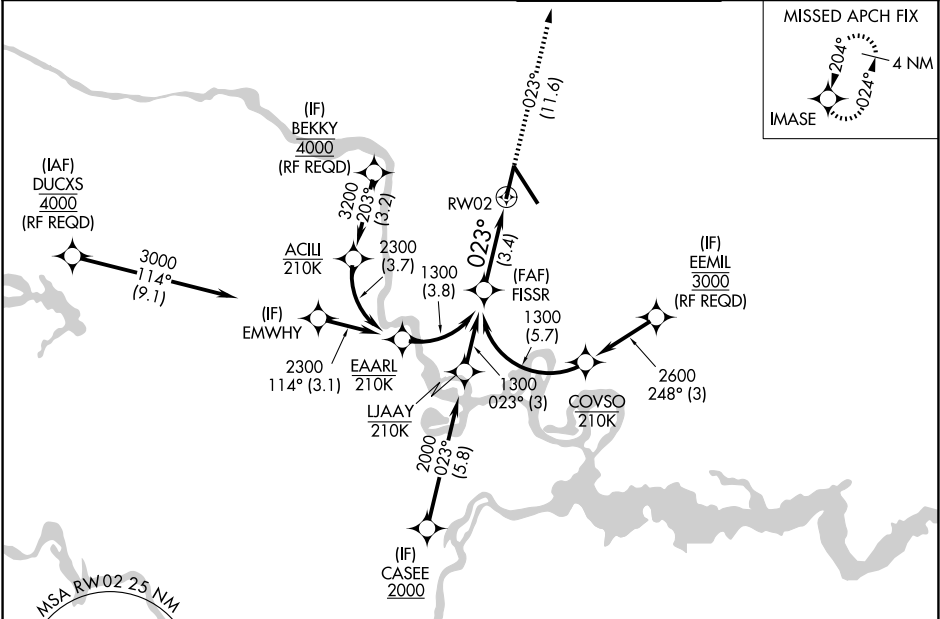

ELEV 168

TDZE 161

See planview for multiple IF locations.

2100 IMASE

↑ tr 023°

FISSR 1300

1300

023°

GP 3.00° TCH 50

RW02

3.4 NM

CATEGORY

A B C D

RNP 0.11 DA 506-¾ 345 (400-¾)

RNP 0.30 DA 595-1 434 (500-1)

AUTHORIZATION REQUIRED

TWR

9 023°

023°

6607 X 150

8002 X 150

34

TDZ/CL Rwy 34

HIRL Rwys 2-20 and 16-34

REIL Rwy 20