

WAAS CH 97520 W34A	APP CRS 338°	Rwy Ldg TDZE 161 Apt Elev 168
--	------------------------	---

RNAV (GPS) Z RWY 34

RICHMOND INTL (RIC)



RNP APCH.

For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -11°C or above 54°C.
For inop ALS, increase LNAV/VNAV all Cats visibility to 1¼ SM and LNAV Cats C and D visibility to RVR 5500.

ALSF-2

MISSED APPROACH:
Climb to 2500 direct IFPIG and hold.

ATIS 119.15 263.025	POTOMAC APP CON 126.4 282.375 (001°-185°) 126.75 307.2 (186°-360°)	RICHMOND TOWER 121.1 257.8	GND CON 121.9 348.6
-------------------------------	--	--------------------------------------	-------------------------------

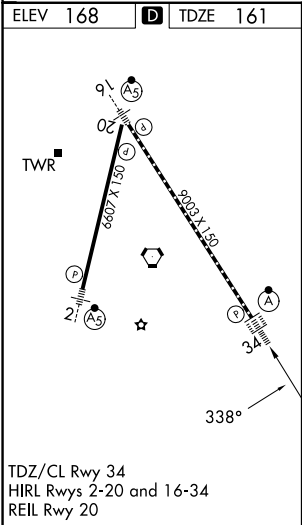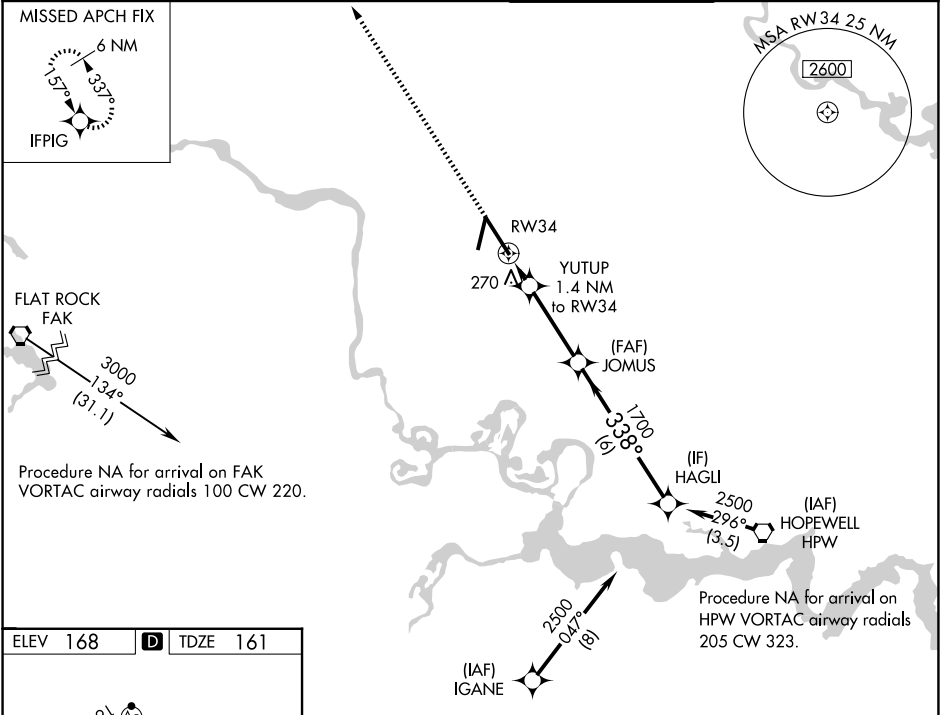

2500	IFPIG	VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 79).		HAGLI	2500
*LNAV only.		YUTUP 1.4 NM to RW34	JOMUS 1700	338°	1700
RW34		1.4 NM	3.3 NM	6 NM	
CATEGORY	A	B	C	D	
LPV DA	361/18		200 (200-½)		
LNAV/VNAV DA	530/37		369 (400-¾)		
LNAV MDA	520/24	359 (400-½)	520/30	359 (400-¾)	
CIRCLING	660-1	492 (500-1)	700-1½ 532 (600-1½)	720-2 552 (600-2)	