

VORTAC RIC 114.1 Chan 88	APP CRS 041°	Rwy Ldg 6607 TDZE 162 Apt Elev 167
--	------------------------	---


VOR RWY 2
RICHMOND INTL (RIC)

T Rwy 2 helicopter visibility reduction below $\frac{3}{4}$ SM NA. For inop ALS, increase S-2 Cat A/B visibility to 1 SM, and Cat C/D to $1\frac{3}{8}$ SM.



MISSED APPROACH: Climbing left turn to 2000 on RIC VORTAC R-018 to EPICS INT/RIC 17.3 DME and hold.

ATIS		POTOMAC APP CON		RICHMOND TOWER		GND CON	
119.15	263.025	126.4	282.375 (001°-185°)	121.1	257.8	121.9	348.6
		126.75	307.2 (186°-360°)				

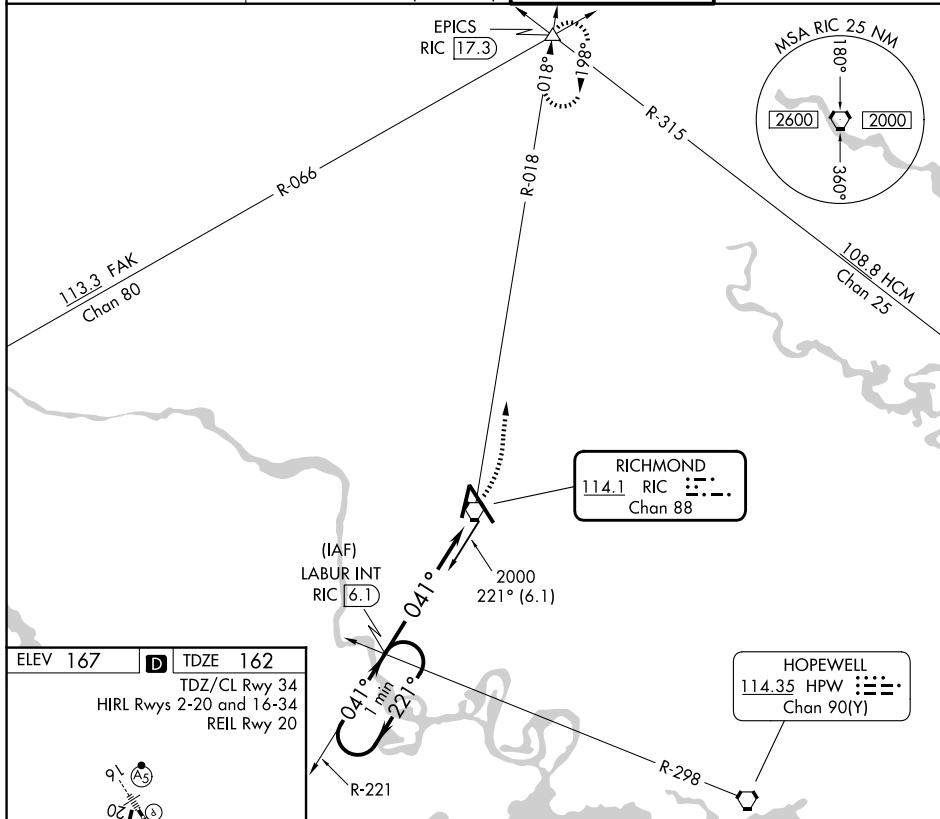

ELEV 167	D	TDZE 162
TDZ/CL Rwy 34 HIRL Rwys 2-20 and 16-34 REIL Rwy 20		

