

VORTAC RIC	APP CRS	Rwy Ldg	6607
114.1	188°	TDZE	168
Chan 88		Apt Elev	168




VOR RWY 20
RICHMOND INTL (RIC)

RADAR required for procedure entry. DME or RADAR required.

MISSED APPROACH: Climbing right turn to 2000 on RIC R-223 to MATOX INT/RIC 16.3 DME and hold.

Rwy 20 helicopter visibility reduction below ¾ SM NA.

ATIS	POTOMAC APP CON	RICHMOND TOWER	GND CON
119.15 263.025	126.4 282.375 (001°-185°) 126.75 307.2 (186°-360°)	121.1 257.8	121.9 348.6

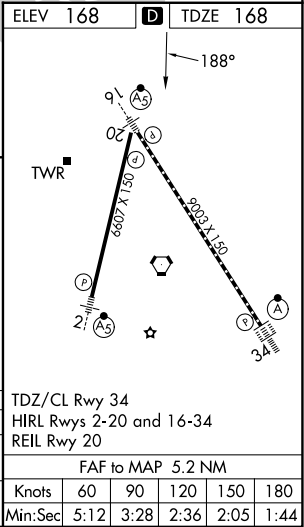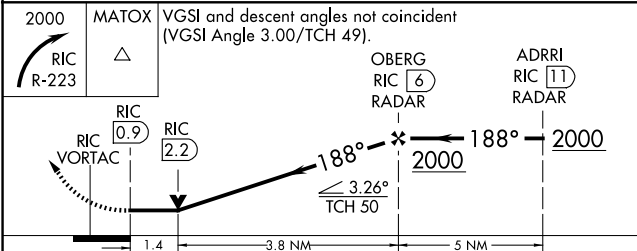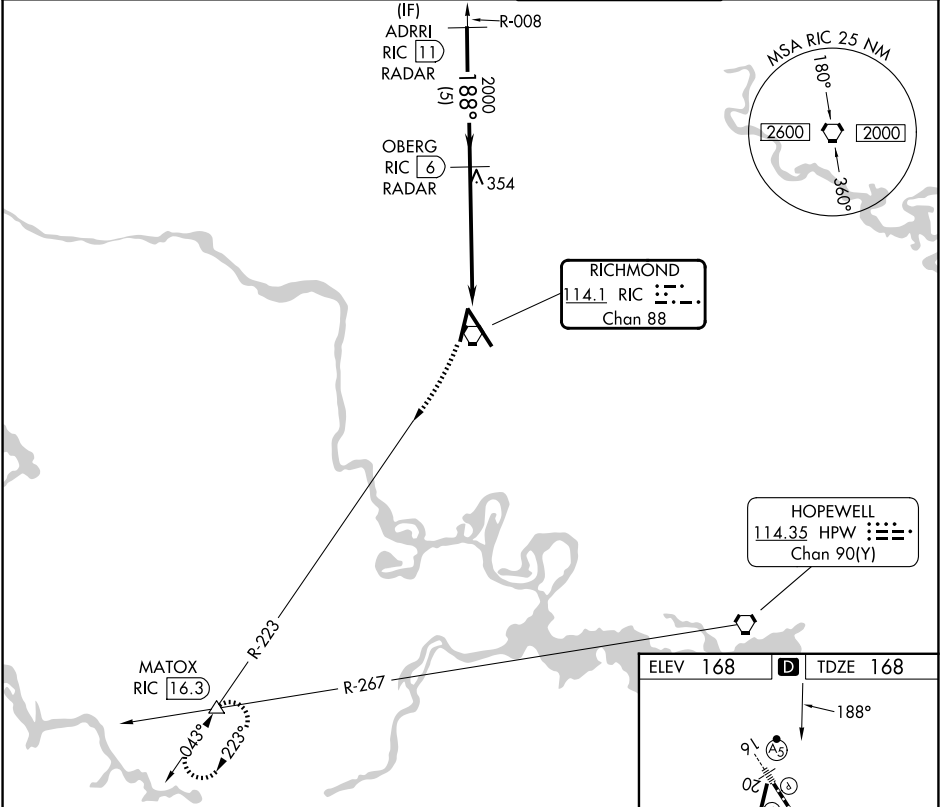

CATEGORY	A	B	C	D
S-20	660-1 492 (500-1)		660-1½ 492 (500-1½)	
CIRCLING	660-1 492 (500-1)		700-1½ 532 (600-1½)	720-2 552 (600-2)

TDZ/CL Rwy 34	
HIRL Rwys 2-20 and 16-34	
REIL Rwy 20	
FAF to MAP 5.2 NM	
Knots	60 90 120 150 180
Min:Sec	5:12 3:28 2:36 2:05 1:44