

LOC I-SAV <u>111.35</u> Chan 50 (Y)	APP CRS 097°	Rwy Ldg 9351 TDZE 30 Apt Elev 50
---	------------------------	---

ILS RWY 10 (SA CAT I & II)
SAVANNAH/HILTON HEAD INTL (SAV)

DME required.


T SA CAT I: Requires specific OPSPEC, MSPEC, or LOA approval and use of HUD to DH. SA CAT II: Reduced lighting: Requires specific OPSPEC, MSPEC, or LOA approval and use of autoland or HUD to touchdown. Procedure NA when tower closed.

MALSR



MISSED APPROACH: Climb to 800 then climbing left turn to 4000 on heading 330° and SAV VORTAC R-001 to TILLS INT/SAV 20 DME and hold.

ATIS 123.75	SAVANNAH APP CON★ 125.3 371.875	SAVANNAH TOWER ★ 125.975 (CTAF) 0 257.8	GND CON 121.9 348.6	UNICOM 122.95
----------------	------------------------------------	--	------------------------	------------------

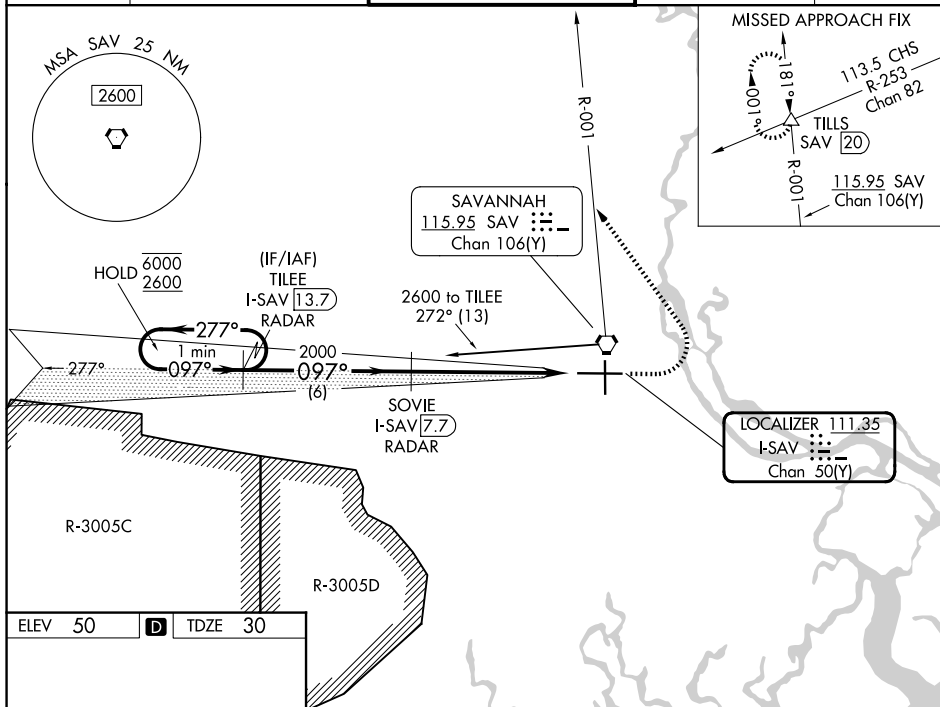

CATEGORY	A	B	C	D
S-ILS 10	SA CAT I	RA 162/14	150	DA 180
S-ILS 10	SA CAT II	RA 116/12	100	DA 130

SA CATEGORY I & II ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED