
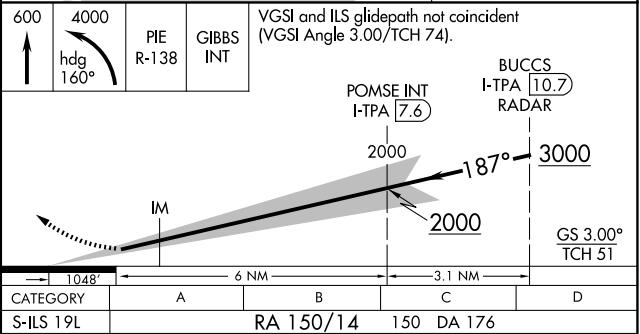
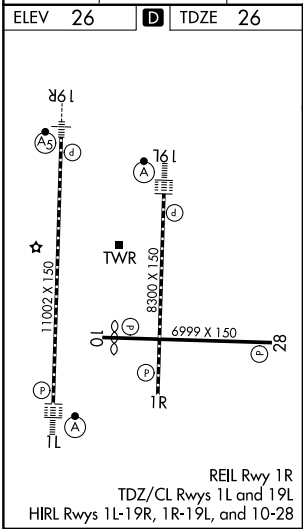


LOC/DME I-TPA	APP CRS	Rwy Ldg	8300
110.3	187°	TDZE	26
Chan 40		Apt Elev	26

ILS RWY 19L (SA CAT I)
TAMPA INTL (TPA)

RADAR required for procedure entry.		ALSIF-2 	MISSED APPROACH: Climb to 600 then climbing left turn to 4000 on heading 160° and on PIE VORTAC R-138 to GIBBS INT and hold.
	Simultaneous approach authorized.		
	Requires specific OPSPEC, MSPEC, or LOA approval.		

ARR	D-ATIS	DEP	TAMPA APP CON	TAMPA TOWER	GND CON	CLNC DEL	CPDLC
126.45		128.475	118.5 307.175	119.5 269.4	121.7 269.4	133.6	

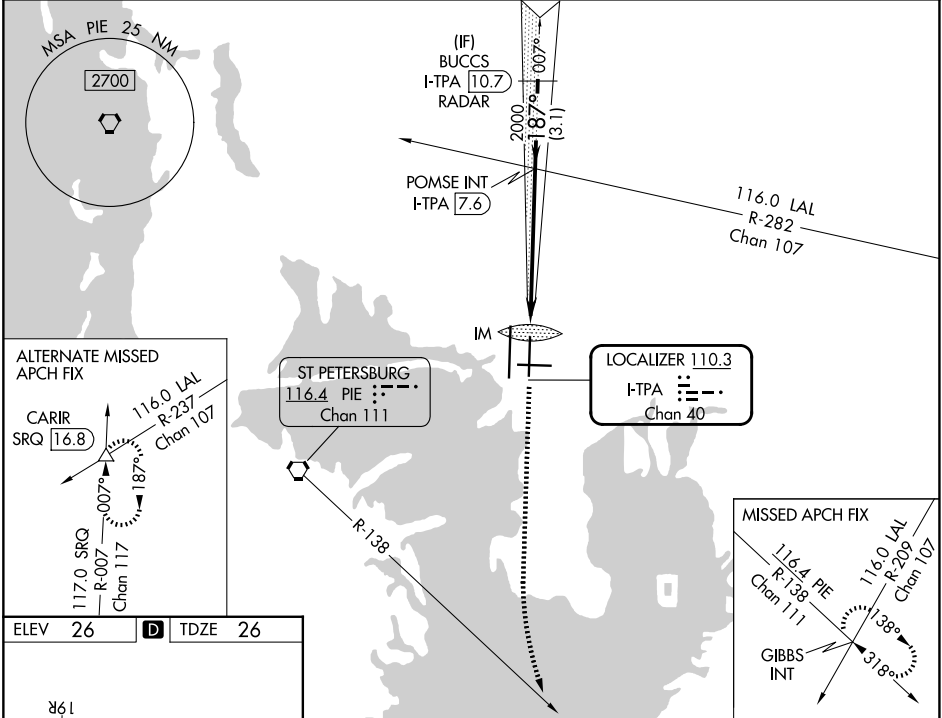

CATEGORY	A	B	C	D
S-ILS 19L	RA 150/14	150	DA 176	