

WAAS CH 87105 W01B	APP CRS 007°	Rwy Ldg 8300 TDZE 21 Apt Elev 26
--	------------------------	---


RNAV (GPS) Y RWY 1R
TAMPA INTL (TPA)

RNP APCH - GPS.

- ▼ For uncompensated Baro-VNAV systems, LNAV/VNAV NA below 4°C or above 54°C.
- ▲ Simultaneous approach authorized with Rwy 1L LNAV procedure NA during simultaneous operations. Use of FD or AP required during simultaneous operations.

MISSED APPROACH: Climb to 2000 direct COBOX and hold.

ARR 126.45	D-ATIS 128.475	DEP 118.5 307.175	TAMPA APP CON 119.5 269.4	TAMPA TOWER 121.7 269.4	GND CON 133.6	CLNC DEL CPDLC
----------------------	--------------------------	-----------------------------	-------------------------------------	-----------------------------------	-------------------------	--------------------------

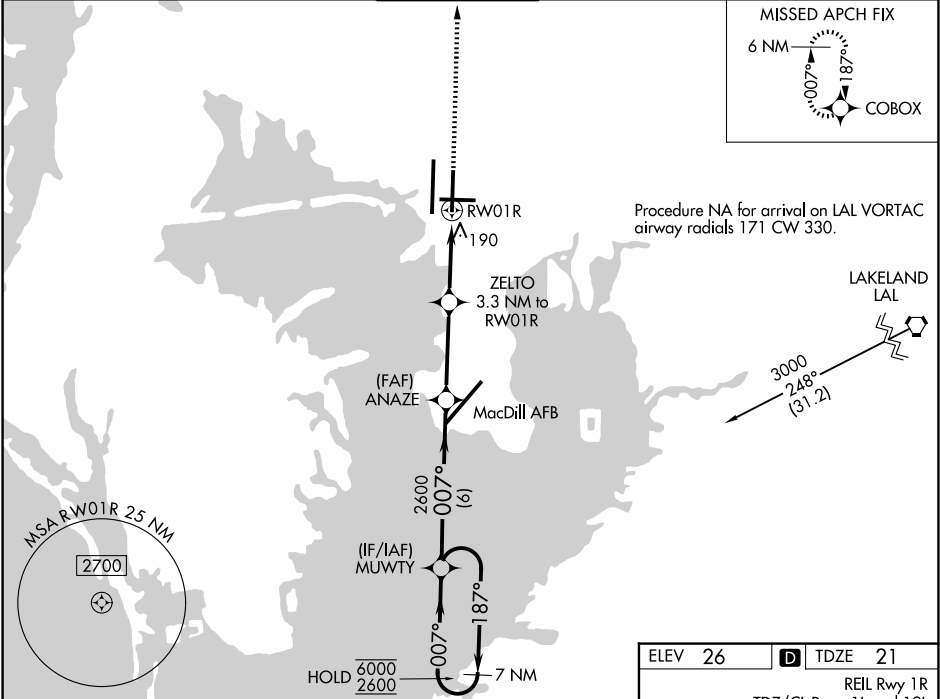

7 NM Holding Pattern		VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 71).		2000	COBOX
MUWTY		ANAZE		2600	
6000 ← 187°		007° →		2600	
GP 3.50°		TCH 55		1300	
6 NM		3.5 NM	2.2 NM	1.1 NM	
CATEGORY	A	B	C	D	E
LPV DA	291/45	270 (300-¾)		NA	
LNAV/VNAV DA	440/60	419 (500-1¼)		NA	
LNAV MDA	440/55	419 (500-1)	440/60	419 (500-1¼)	
CIRCLING	600-1	574 (600-1)	680-1¾ 654 (700-1¾)	980-3	954 (1000-3)

