



APP CRS	Rwy Ldg	8500
308°	TDZE	430
	Apt Elev	477

RNAV (RNP) Y RWY 31L

PALM SPRINGS INTL (PSP)

RNP AR APCH - GPS, RF, min RNP 0.30. Authorization required.	MISSED APPROACH: Climb to 900 then climbing right turn to 4000 direct TANFY and track 107° to BANPE and track 144° to TRM VORTAC and hold. Missed approach requires minimum climb of 365 feet per NM to 2200; if unable to meet climb gradient, see RNAV (GPS) Z RWY 31L.
For uncompensated Baro-VNAV systems, procedure NA below 4°C or above 54°C.	

ATIS 124.65	SOCAL APP CON 126.7 370.95 135.275 251.1	PALM SPRINGS TOWER* 119.7 (CTAF) 377.05	GND CON 121.9	CLNC DEL 128.35	UNICOM 122.95
----------------	--	--	------------------	--------------------	------------------

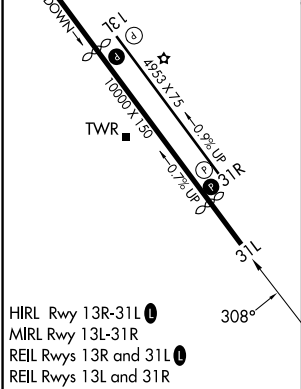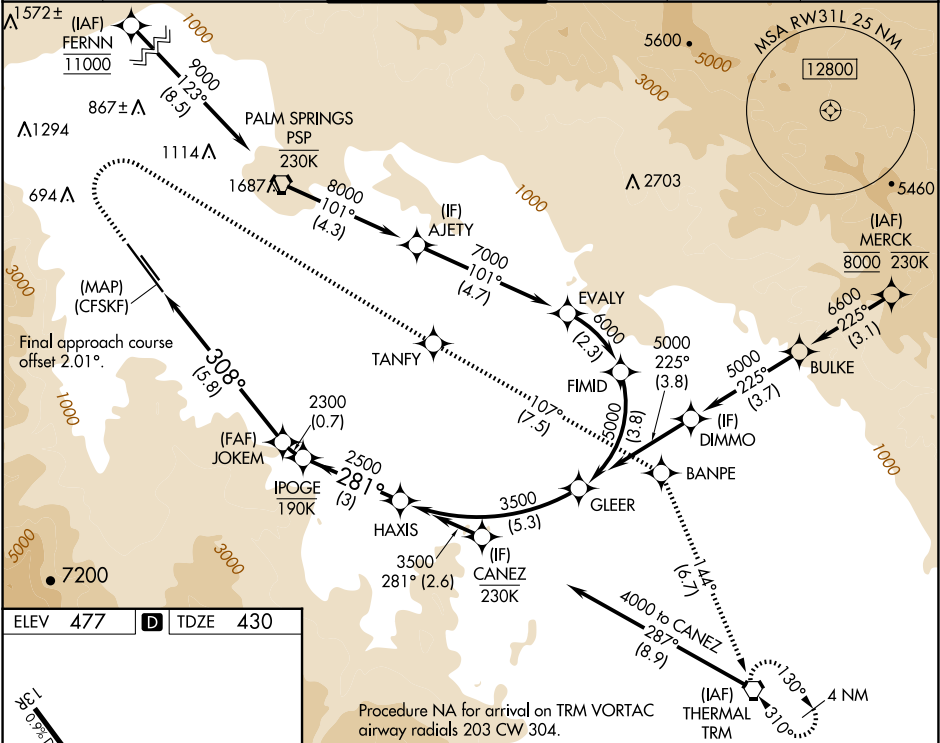

900 ↑	4000 ↗	TANFY ✦ tr 107°	BANPE ✦ tr 144°	TRM ◡	IPOGE				HAXIS
See planview for multiple IF locations.					JOKEM	3500			
(CFSKF)					2300	2500	281°	GP 3.00° TCH 55	
					308°	2300			
					5.8 NM	0.7 NM	3 NM		
CATEGORY	A		B		C		D		
RNP 0.13 DA			680-¾		250 (300-¾)				
RNP 0.30 DA			718-⅞		288 (300-⅞)				
AUTHORIZATION REQUIRED									