27 NOV 2025

ಠ 25

DEC 2025

JAKIE SIX ARRIVAL (RNAV) Transition Routes

CINCINNATI APP CON RNAV 1 - DME/DME/IRU or GPS. 119.7 254.25 RADAR required. D-ATIS 134.375 **JAKIE** See following page for 14000 arrival routes. 10 NM **HRMBE** FL210 16000 BLAIZ 10 NM MELNZ CHEDA **CUBIM ARTUR** ARTUR TRANSITION (ARTUR.JAKIE6): CUBIM TRANSITION (CUBIM.JAKIE6): DOLLI TRANSITION (DOLLI.JAKIE6): VOLUNTEER TRANSITION (VXV.JAKIE6): VOLUNTEER (CONTINUED ON FOLLOWING PAGE) NOTE: Chart not to scale.


27 NOV 2025

ಠ 25

DEC

JAKIE SIX ARRIVAL (RNAV) Arrival Routes

COVINGTON, KENTUCKY CINCINNATI APP CON 119.7 254.25 RADAR required.

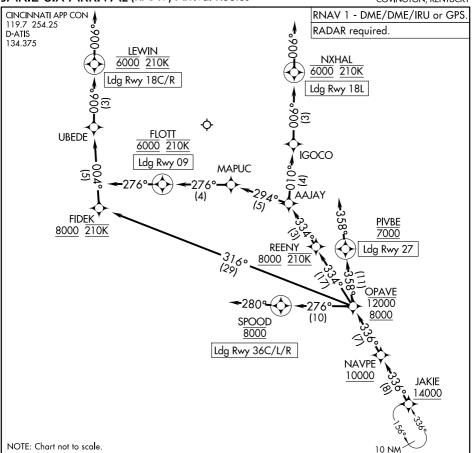

ARRIVAL ROUTE DESCRIPTION

From JAKIE on track 336° to cross NAVPE at or above 10000, then on track 336° to cross OPAVE between 8000 and 12000.

LANDING RUNWAY 9: From OPAVE on track 334° to cross REENY at or above 8000 and at 210K. then on track 334° to AAJAY, then on track 294° to MAPUC, then on track 276° to cross FLOTT at 6000 and at 210K, then on track 276°. Expect RADAR vectors to final approach course. LANDING RUNWAYS 18C/R: From OPAVE on track 316° to cross FIDEK at or above 8000 and at 210K.

then on track 004° to UBEDE, then on track 006° to cross LEWIN at 6000 and at 210K, then on track 006°. Expect RADAR vectors to final approach course.

LANDING RUNWAY 18L: From OPAVE on track 334° to cross REENY at or above 8000 and at 210K. then on track 334° to AAJAY, then on track 010° to IGOCO, then on track 006° to cross NXHAL at 6000 and at 210K, then on track 006°. Expect RADAR vectors to final approach course.

LANDING RUNWAY 27: From OPAVE on track 358° to cross PIVBE at 7000, then on track 358°.

Expect RADAR vectors to final approach course.

LANDING RUNWAYS 36L/C/R: From OPAVE on track 276° to cross SPOOD at 8000, then on track 280°. Expect RADAR vectors to final approach course.