


WAAS CH 78139 W05A	APP CRS 050°	Rwy Idg TDZE 832 Apt Elev 832	6001
--	------------------------	---	-------------

RNAV (GPS) RWY 5

KOKOMO MUNI (OKK)

RNP APCH - GPS.		MISSED APPROACH: Climb to 3000 direct HADUN and hold.	
▼ ▲ For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 54°C.			
AWOS-3PT 128.675	GRISSEM APP CON★ 121.05 338.275	CLNC DEL 120.0	UNICOM 123.0 (CTAF) 0

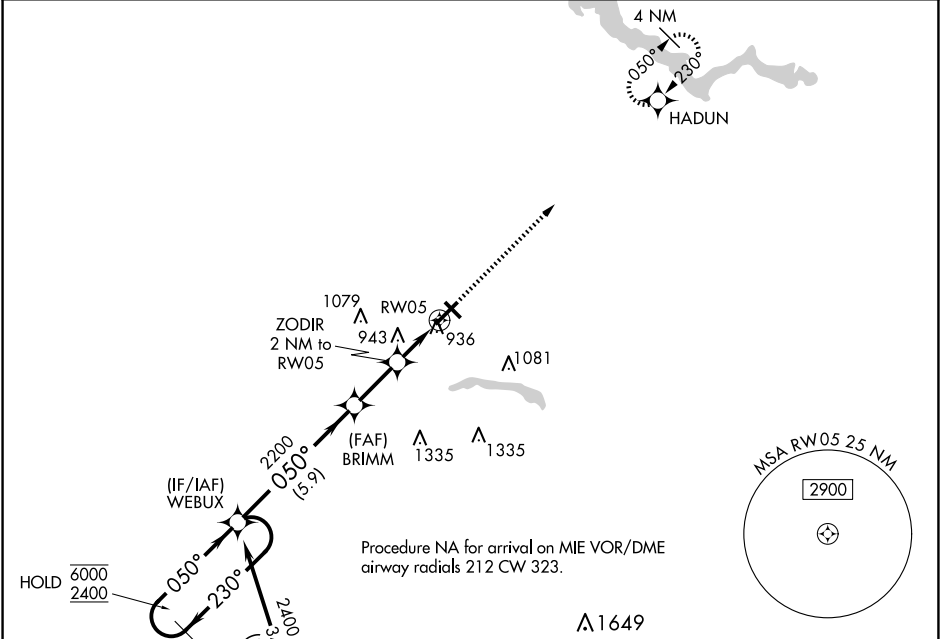

4 NM Holding Pattern		ELEV 832		TDZE 832	
6000 2400		BRIMM		HADUN	
GP 3.00° TCH 40		ZODIR 2 NM to RW05		RW05	
VGSi and RNAV glidepath not coincident (VGSi Angle 3.00/TCH 35).		1 NM to RW05		RW05	
2200		1500		050°	
5.9 NM		2.2 NM		1 NM	
CATEGORY	A	B	C	D	
LPV DA	1082-¾		250 (300-¾)		
LNAV/VNAV DA	1102-⅞		270 (300-⅞)		
LNAV MDA	1200-1		368 (400-1)		
CIRCLING	1260-1 428 (500-1)	1300-1 468 (500-1)	1400-1½ 568 (600-1½)	1420-2 588 (600-2)	