
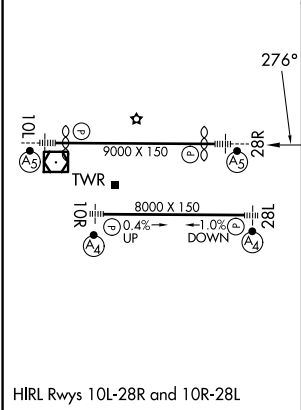


APP CRS	Rwy Ldg	8394
276°	TDZE	7
	Apt Elev	65

RNAV (RNP) Z RWY 28R
FORT LAUDERDALE/HOLLYWOOD INTL (FLL)

RNP AR APCH - GPS. RADAR required.	MALSR	MISSED APPROACH: Climb to 800 then climbing right turn to 4000 direct HUKUK and hold, continue climb-in-hold to 4000.
Simultaneous approach authorized. For uncompensated Baro-VNAV systems, procedure NA below 7°C or above 54°C. For inop ALS, increase RNP 0.15 visibility to RVR 5500 and increase RNP 0.30 visibility to 1¾ SM.		

D-ATIS 135.0	MIAMI APP CON 133.775 285.6	FORT LAUDERDALE TOWER 119.3 257.8	GND CON 121.4
-----------------	--------------------------------	--------------------------------------	------------------

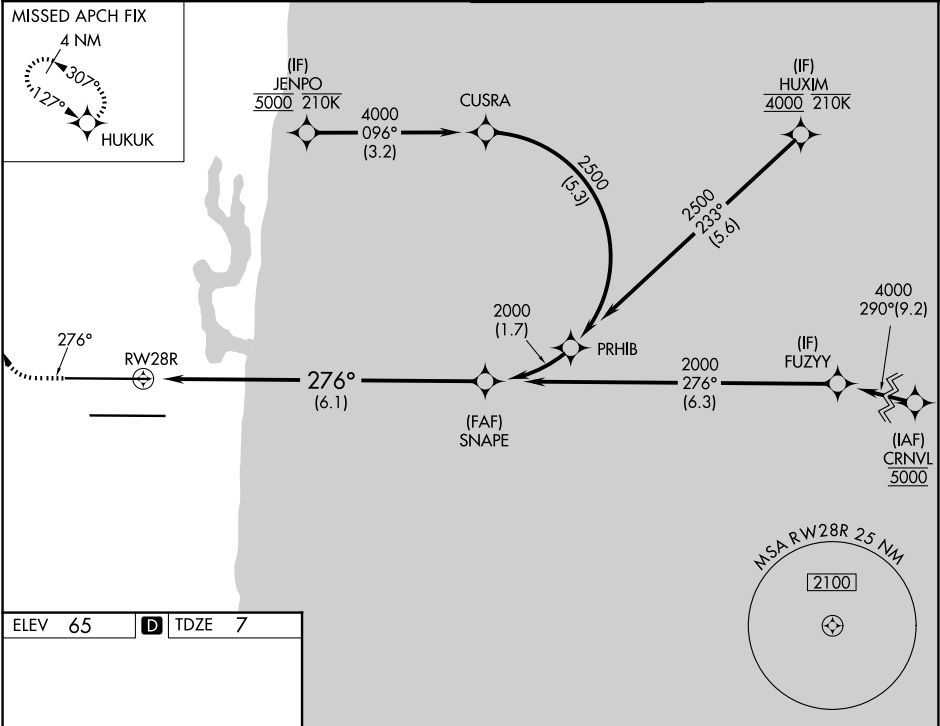

800	4000	HUKUK	VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 69).	
See planview for multiple IF locations.				
GP 3.00° TCH 49				
CATEGORY	A	B	C	D
RNP 0.15 DA	362/40		355 (300-¾)	
RNP 0.30 DA	618-1⅞		611 (600-1⅞)	
AUTHORIZATION REQUIRED				