
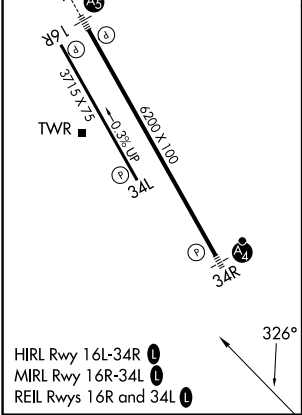


WAAS CH 56239 W34B	APP CRS 326°	Rwy Ldg TDZE 182 Apt Elev 192
--	------------------------	---

RNAV (GPS) RWY 34L

MANASSAS RGNL/HARRY P DAVIS FLD (HEF)

▼ ▲	DME/DME RNP-0.3 NA. When local altimeter setting not received, use Washington Dulles Intl altimeter setting and increase all MDA 60 feet; increase LNAV Cat C/D and Circling Cat C and D visibility ¼ mile. Helicopter visibility reduction below ¾ SM NA.		MISSED APPROACH: Climbing left turn to 3000 direct CSN VORTAC and hold.	
	ATIS 125.175	POTOMAC APP CON 128.525 306.925	MANASSAS TOWER ★ 133.1 (CTAF) 0 360.75	GND CON 121.8

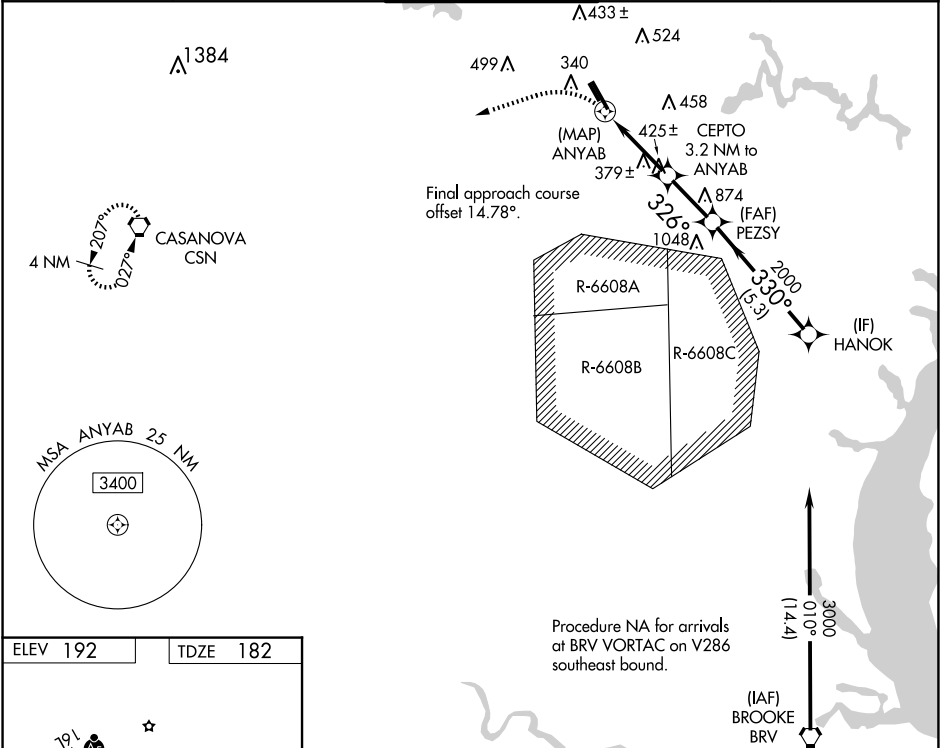

3000 CSN		VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 43).		HANOK	
0.9 NM to ANYAB		CEPTO 3.2 NM to ANYAB		PEZSY	
ANYAB		1260		2000	
0.4		0.9		2.4 NM	
CATEGORY		A		B	
LP		MDA		640-1 3/8	
LNAV		MDA		680-1 3/8	
CIRCLING		720-1		740-1	
		528 (600-1)		548 (600-1)	
		740-1		840-1 3/4	
		548 (600-1)		648 (700-1 3/4)	
		840-1 3/4		880-2 1/4	
		648 (700-1 3/4)		688 (700-2 1/4)	