

LOC/DME I-IAH <u>109.7</u> Chan 34	APP CRS 087°	Rwy Ldg 9402 TDZE 95 Apt Elev 96
--	------------------------	---

ILS RWY 8R (SA CAT I & II)

GEORGE BUSH INTCNL/HOUSTON (IAH)

RNAV 1-GPS or RADAR required for procedure entry, DME.

MALSR




MISSED APPROACH: Climb to 3000 on heading 087° and on DAS VORTAC R-242 to DAS VORTAC and hold.

D-ATIS
124.05


HOUSTON APP CON
120.05 379.1 E
124.35 316.15 W

HOUSTON TOWER
125.35 290.2

GND CON
118.575

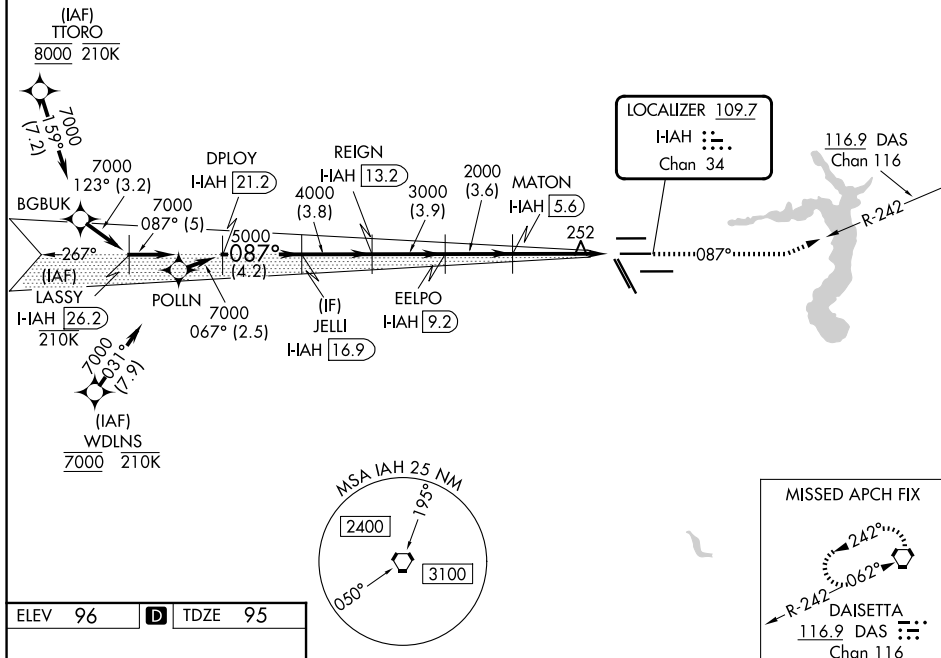


ELEV	96	D	TDZE	95
------	----	----------	------	----

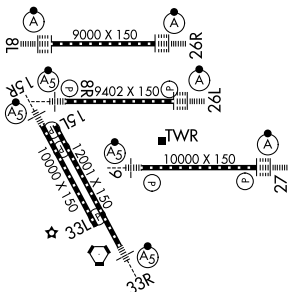

TDZ/CL Rwy 8R, 8L, 15R, 26R, 26L,
27 and 33L
HIRL qll Rwy

VGSI and ILS glidepath not coincident
(VGSI Angle 3.00/TCH 72).

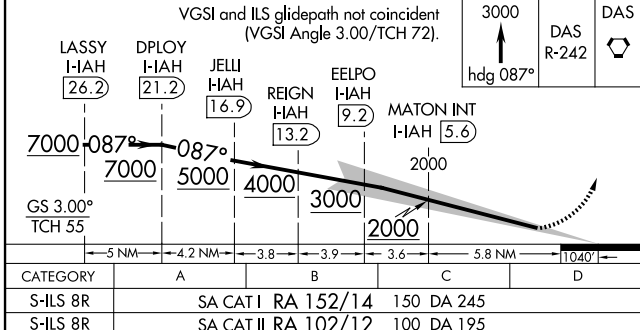

SA CATEGORY I and II ILS SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED