

WAAS CH 69546 W32A	APP CRS 314°	Rwy Ldg 3600 TDZE 1446 Apt Elev 1446
--	------------------------	---

RNAV (GPS) RWY 32
JACKSON MUNI (MJQ)

JACKSON MUNI (M.J.Q)

RNP APCH - GPS.	
-----------------	--

T For uncompensated Baro-VNAV systems, LNAV/VNAV NA
A below -17°C or above 54°C. Circling NA to Rwy 4 and 22.

MISSED APPROACH: Climb to 3100 direct FETGI and hold.


AWOS-3
118.1

MINNEAPOLIS CENTER
127.75 257.7

GCO
121,725

UNICOM
122.8 (CTAF) **L**


MISSED APCH FIX

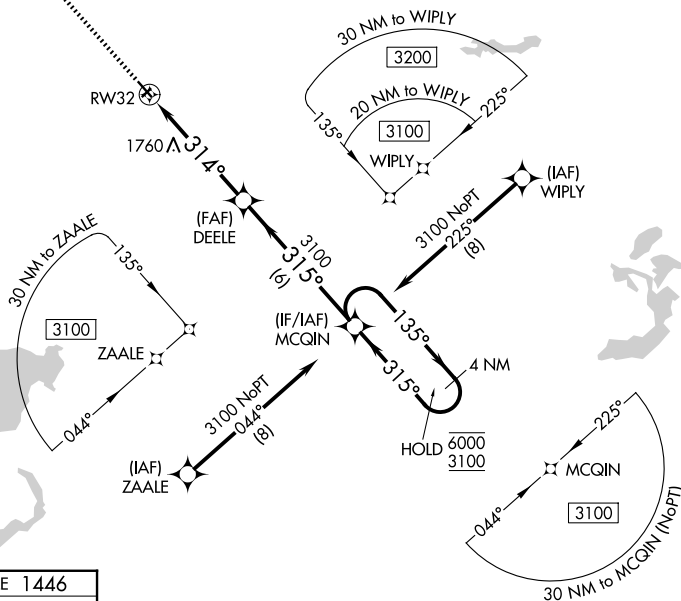

ELEV 1446	D	TDZE 1446
-----------	----------	-----------


D

TDZE 1446

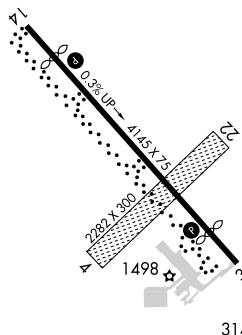RFIL Rwyys 14 and 32 

MIRL Rwy 14-32 L

3100	FETGI	VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 26).
------	-------	--

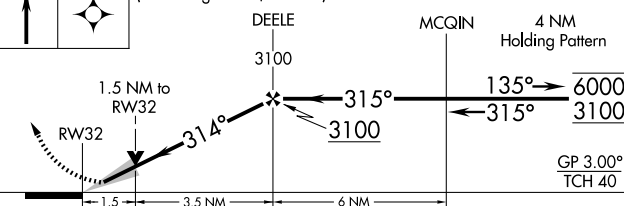

CATEGORY		A	B	C	D
LPV	DA	1696-1	250 (300-1)	NA	
LNAV/ VNAV	DA	1960-1 $\frac{3}{8}$	514 (600-1 $\frac{3}{8}$)	NA	
LNAV MDA		1960-1	514 (600-1)	NA	
CIRCLING		2040-1	594 (600-1)	NA	