

WAAS CH 97626 W26A	APP CRS 257°	Rwy Ldg 10000 TDZE 27 Apt Elev 30
--	------------------------	--

RNAV (GPS) Z RWY 26

JACKSONVILLE INTL (JAX)

RNP APCH-GPS.

▼


For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -5°C or above 54°C. For inoperative MALSR, increase LNAV/VNAV all Cats visibility to RVR 4500 and increase LNAV Cats C/D visibility to RVR 5500.

MALSR



MISSED APPROACH: Climb to 2000 direct UDAQI and hold.

D-ATIS 125.85	JACKSONVILLE APP CON 119.0 269.9	JACKSONVILLE TOWER 118.3 317.7	GND CON 121.9 348.6
-------------------------	--	--	-------------------------------

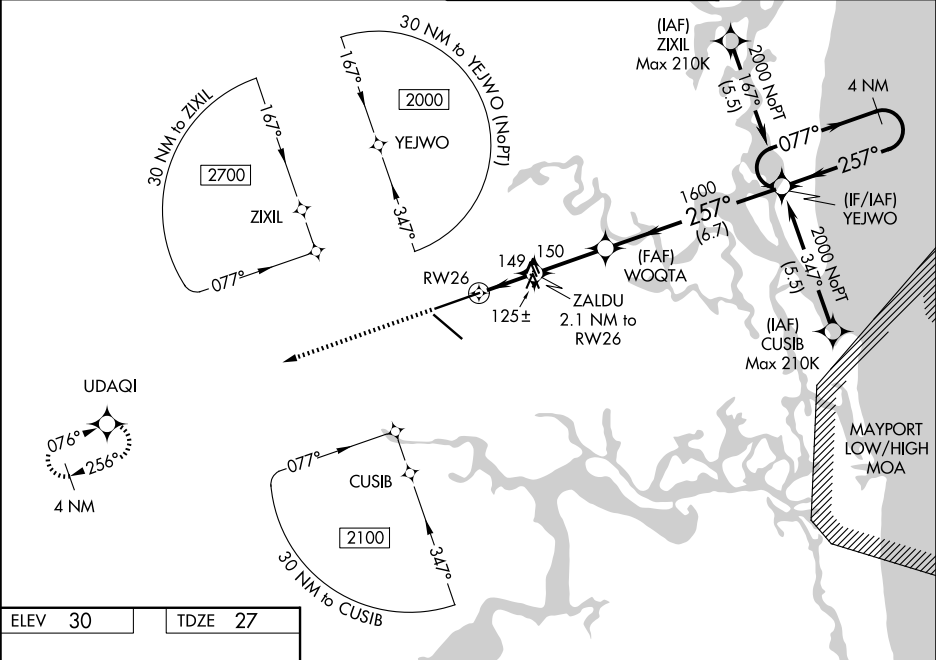

ELEV 30	TDZE 27
---------	---------

2000

UDAI

257°



VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 70).

4 NM Holding Pattern

YEJWO

2000

GP 3.00° TCH 49

1 NM

1.1 NM

2.7 NM

6.7 NM

CATEGORY	A	B	C	D
LPV DA	227/18 200 (200-½)			
LNAV/VNAV DA	300/24 273 (300-½)			
LNAV MDA	400/24 373 (400-½)		400/35 373 (400-¾)	
CIRCLING	520-1 490 (500-1)		580-1½ 640-2 550 (600-1½) 610 (700-2)	

REIL Rwy 32
TDZL/RCLS Rwy 8, 14, and 26
HIRL Rwy 8-26 and 14-32