

LOC I-UGZ <u>111.9</u>	APP CRS 227°	Rwy Idg TDZE Apt Elev	5501 134 134
----------------------------------	------------------------	-----------------------------	---

ILS or LOC RWY 23

DME or RADAR required.



T When local altimeter setting not received, use Smithfield altimeter
A setting and increase DA to 388 and all MDAs 60 feet, increase
S-LOC Cats C/D visibility $\frac{1}{4}$ SM, Circling Cats C/D $\frac{1}{4}$ SM.
Inop table does not apply to S-ILS 23.

ODALS



MISSED APPROACH: Climb to 900 then climbing right turn to 2000 on heading 040° and on ISO VORTAC R-302 to WADUG INT/ISO 23.3 DME and hold.

AWOS-3P 118.975	SEYMOUR JOHNSON APP CON ★ 121.175 290.9	UNICOM 122.975 (CTAF) 0
---------------------------	---	-----------------------------------

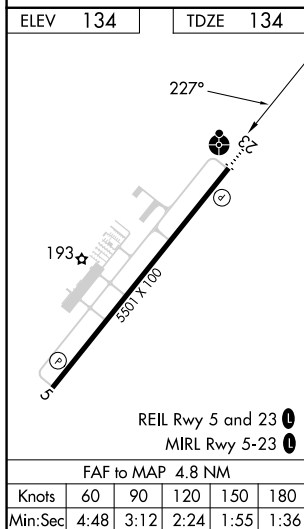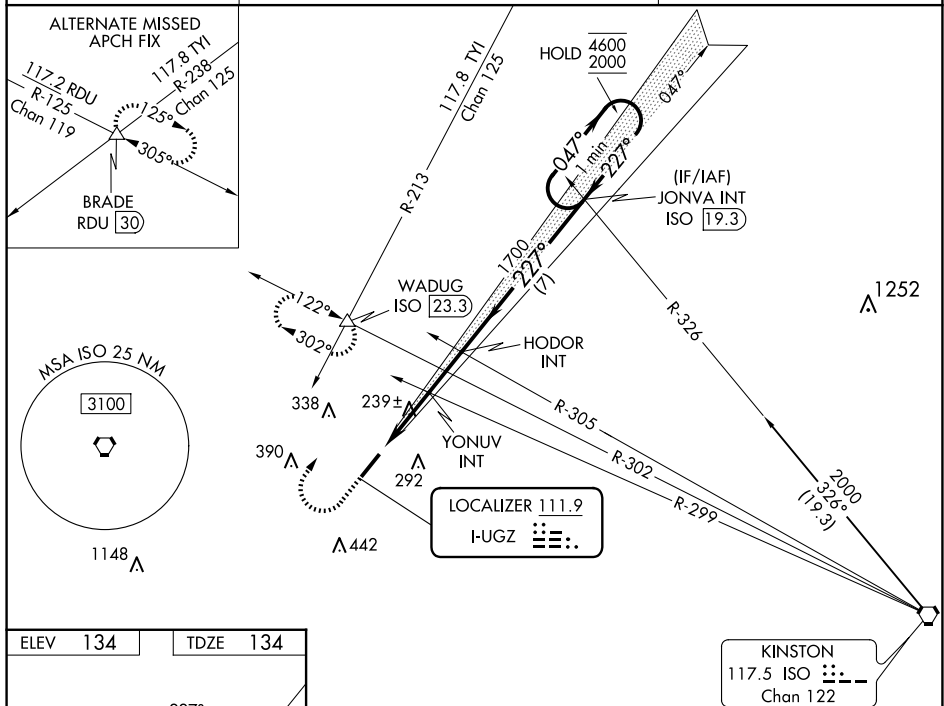

900 ↑	2000 hdg 040°	ISO R-302	WADUG △	VGS1 and ILS glidepath not coincident (VGS1 Angle 3.00/TCH 44).			
				One Minute Holding Pattern			
				JONVA INT 047° → 4600 ← 227° 2000 227° 1700 1100 2.9 NM 1.9 NM 7 NM GS 3.00° TCH 51			
CATEGORY	A		B		C		D
S-ILS 23			334- ³ / ₄		200 (200- ³ / ₄)		
S-LOC 23	500- ³ / ₄		366 (400- ³ / ₄)		500-1		366 (400-1)
CIRCLING	580-1 446 (500-1)		640-1 506 (600-1)		760-1 ³ / ₄ 626 (700-1 ³ / ₄)		760-2 626 (700-2)