

WAAS CH 97701 W10A	APP CRS 100°	Rwy Ldg TDZE 857 Apt Elev 868
--	------------------------	---

RNAV (GPS) RWY 10

FAIRFIELD COUNTY (LHQ)

RNP APCH - GPS.


▼

⚠

Rwy 10 helicopter visibility reduction below ¾ SM NA. When local altimeter setting not received, use Rickenbacker Intl altimeter setting and increase all MDAs 60 feet and LNAV visibility Cat C ¼ SM, and Circling visibility Cat C ¼ SM. When Circling Rwy 28 at night, operational VGSI required, remain on or above VGSI glidepath until threshold.

MISSED APPROACH:
Climb to 2800 direct
DIPAC and hold.

ASOS 118.375	COLUMBUS APP CON 134.0 279.6	CLNC DEL 121.65	UNICOM 122.725 (CTAF) 0
------------------------	--	---------------------------	-----------------------------------

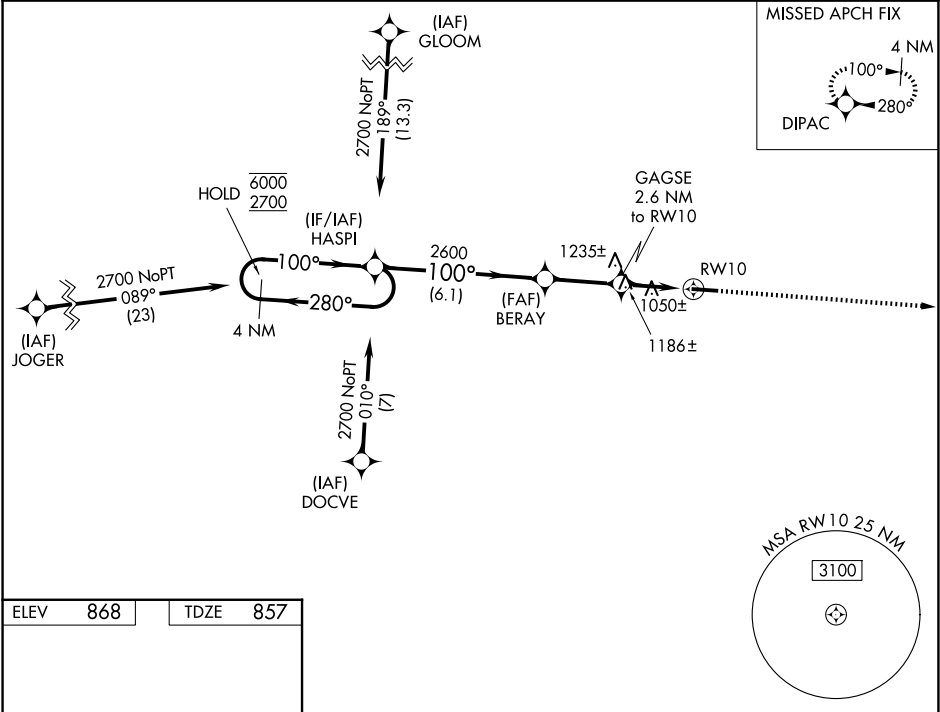

ELEV 868 TDZE 857

4 NM Holding Pattern		HASPI		BERY		GAGSE 2.6 NM to RW10		2800	DIPAC
6000 ← 280°		100° →		100°		3.00° TCH 40 1720		↑	✧
2700									
		6.1 NM		2.8 NM		2.6 NM			
CATEGORY		A	B	C	D				
LP MDA		1300-1	443 (500-1)	1300-1½ 443 (500-1½)	NA				
LNAV MDA		1440-1	583 (600-1)	1440-1¾ 583 (600-1¾)	NA				
CIRCLING		1500-1 632 (700-1)	1540-1 672 (700-1)	1620-2¼ 752 (800-2¼)	NA				

REIL Rwys 10 and 28 0

MIRL Rwy 10-28 0

EC-2, 27 NOV 2025 to 25 DEC 2025

EC-2, 27 NOV 2025 to 25 DEC 2025