

APP CRS
095°

Rwy Idg
TDZE
2922

Apt Elev
2933

RNAV (GPS) RWY 9

PINE MOUNTAIN LAKE (E45)

RNP APCH-GPS.


▼

▲ NA

Procedure NA at night. Rwy 9 helicopter visibility reduction below 1 SM NA. Use Columbia altimeter setting.

MISSED APPROACH: Climbing right turn to 7000 direct HOFED and hold, continue climb-in-hold to 7000.

O22 AWOS-3 124.65	OAKLAND CENTER 121.25 327.0	CTAF 122.9
-----------------------------	---------------------------------------	----------------------

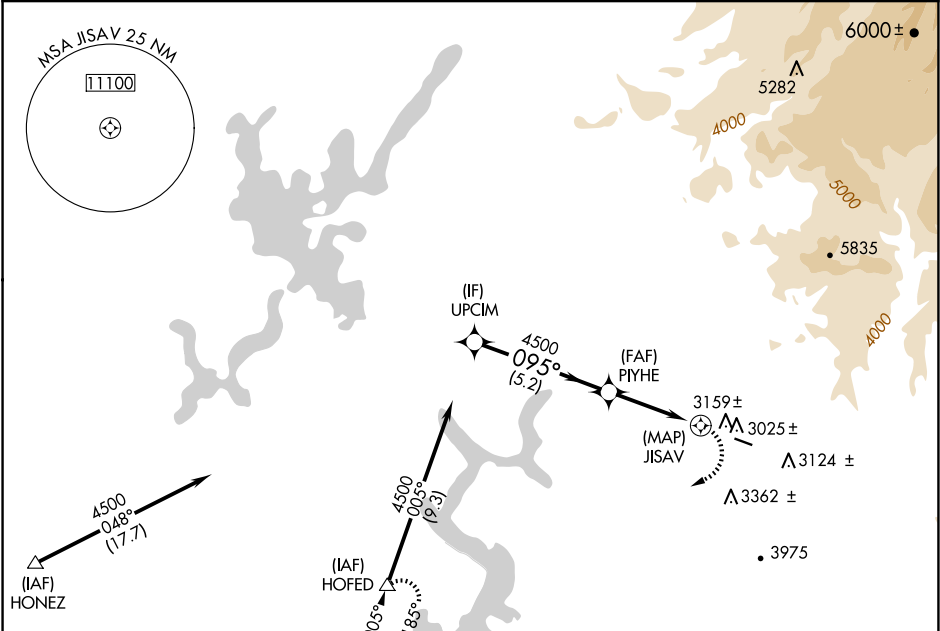

ELEV 2933

TDZE 2922

095°

HOFED

△

7000

HOFED

UPCIM

PIYHE

JISAV

4500

4500

3.04°

TCH 40

5.2 NM

3.5 NM

1.4 NM

CATEGORY

A

B

C

D

LNAV MDA

4060-1¾

1138 (1200-1¾)

NA

MIRL Rwy 9-27

VGSI and RNAV glidepath not coincident (VGSI Angle 4.50/TCH 24).

UPCIM

PIYHE

JISAV

4500

4500

3.04°

TCH 40

5.2 NM

3.5 NM

1.4 NM

CATEGORY

A

B

C

D

LNAV MDA

4060-1¾

1138 (1200-1¾)

NA

MIRL Rwy 9-27