


WAAS CH 58041 W11A	APP CRS 111°	Rwy Idg 3200 TDZE 29 Apt Elev 29
--	------------------------	---

RNAV (GPS) RWY 11

BUCKLAND (BVK)(PABL)

RNP APCH.	MISSED APPROACH: Climb to 3100 direct JAMUR and hold, continue climb-in-hold to 3100.
▼ Baro-VNAV and VDP NA when using Selawik altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -21°C or above 54°C. ▲ When local altimeter setting is not received use Selawik altimeter setting: increase DA to 387 feet and all visibilities $\frac{3}{8}$ SM; increase all MDAs 120 feet and visibility Cat C $\frac{1}{4}$ SM.	

AWOS-3P 135.15	ANCHORAGE CENTER 119.2 263.0	KOTZEBUE RADIO 122.3	CTAF 122.9 0
--------------------------	--	--------------------------------	------------------------

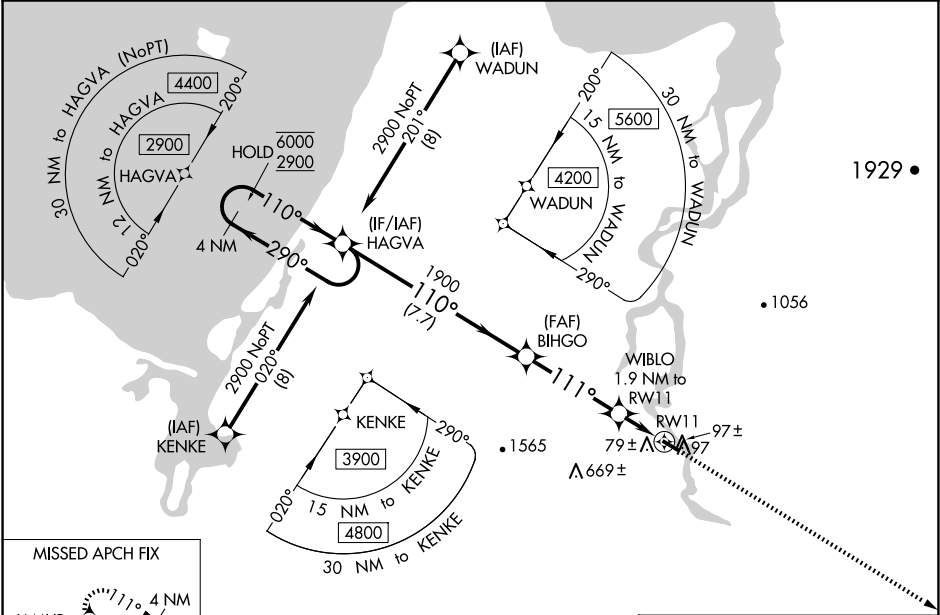

MISSED APCH FIX		ELEV 29		TDZE 29	
JAMUR		3100		JAMUR	
4 NM Holding Pattern		VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 25).		*RNAV only.	
6000 ← 290°		1900		*0.9 NM to RW11	
2900 → 110°		7.7 NM		*660	
GP 3.00°		3.9 NM		RW11	
TCH 30		1 NM		29	
CATEGORY	A	B	C	D	
LPV DA	279-1	250 (300-1)		NA	
LNAV/VNAV DA	279-1	250 (300-1)		NA	
LNAV MDA	340-1	311 (400-1)		NA	
CIRCLING	540-1	511 (600-1)	640-1 $\frac{3}{4}$ 611 (700-1 $\frac{3}{4}$)	NA	MRL Rwy 11-29 0