

WAAS CH 42825 W10A	APP CRS 096°	Rwy Idg TDZE 7 Apt Elev 7	3000
--	------------------------	---	-------------

RNAV (GPS) RWY 10

MIAMI HOMESTEAD GENERAL AVIATION (X51)


▼

NA

Baro-VNAV NA when using Miami Exec altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C (5°F) or above 54°C (130°F). DME/DME RNP-0.3 NA. When local altimeter setting not received, use Miami Exec altimeter setting: increase LPV DA to 284; increase LNAV/VNAV DA to 284; increase all MDA 40 feet.

MISSED APPROACH: Climb to 500 then climbing left turn to 2000 direct HOLMU and hold.

AWOS-3 118.375	MIAMI APP CON 125.5 354.1	UNICOM 122.8 (CTAF)
--------------------------	-------------------------------------	-------------------------------

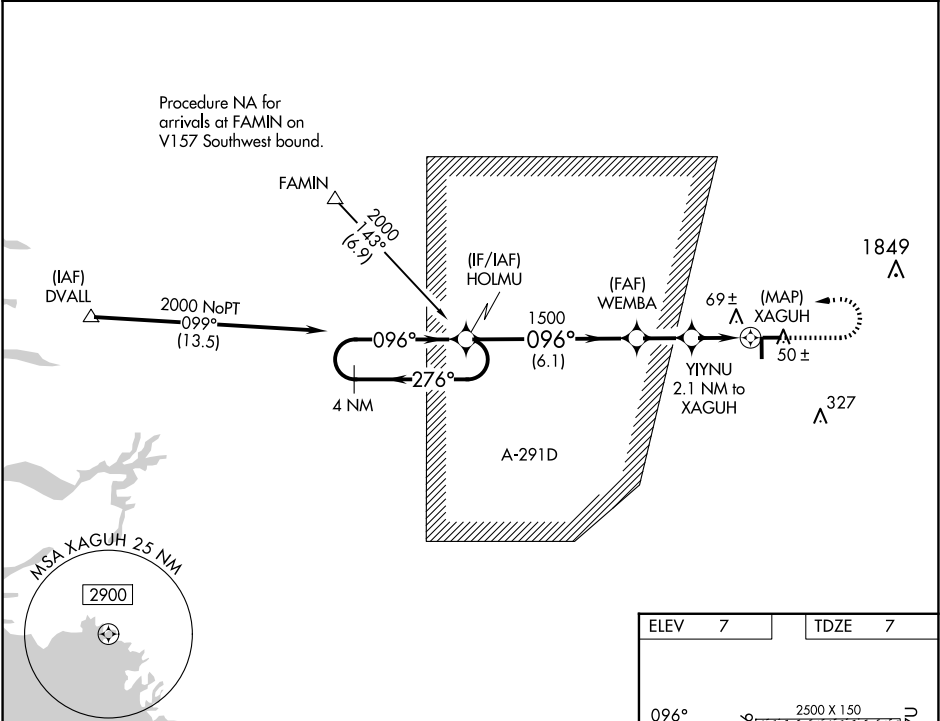

	4 NM Holding Pattern		VGSI and descent angles not coincident. (VGSI Angle 3.00/TCH 71).		500	2000	HOLMU
	2000 ← 276° 096° →		096°		1500	YIYNU 2.1 NM to XAGUH	*LNAV only.
	GP 3.00° TCH 40		1500		*860		
	← 6.1 NM		2 NM		2.1 NM 0.5 NM		
CATEGORY	A	B	C	D			
LPV DA	257-7/8	250 (300-7/8)	NA				
LNAV/VNAV DA	257-7/8	250 (300-7/8)	NA				
LNAV MDA	320-1	313 (400-1)	NA				
CIRCLING	380-1 373 (400-1)	460-1 453 (500-1)	NA				