


TACAN RWY 5

TACAN MCF Chan 47	APCH CRS 043°	Rwy Idg 11,421 TDZE 10 Arpt Elev 14	AL-418 [USAF]	MACDILL AFB (KMCF)
* When ALS inop, increase CAT AB RVR to 55, vis to 1 mile; CAT CDE RVR to 60, vis to 1½ miles. ** Circling not authorized NW of Rwy 5-23.			ALSF-1 	† MISSED APPROACH: Climb to 2700 via MCF R-075 to 22 DME and hold. Cross 8 DME at 1700.
ATIS 133.825 270.1	TAMPA APP CON 124.95 354.0	TOWER 120.175 294.7	GND CON 118.575 275.8	

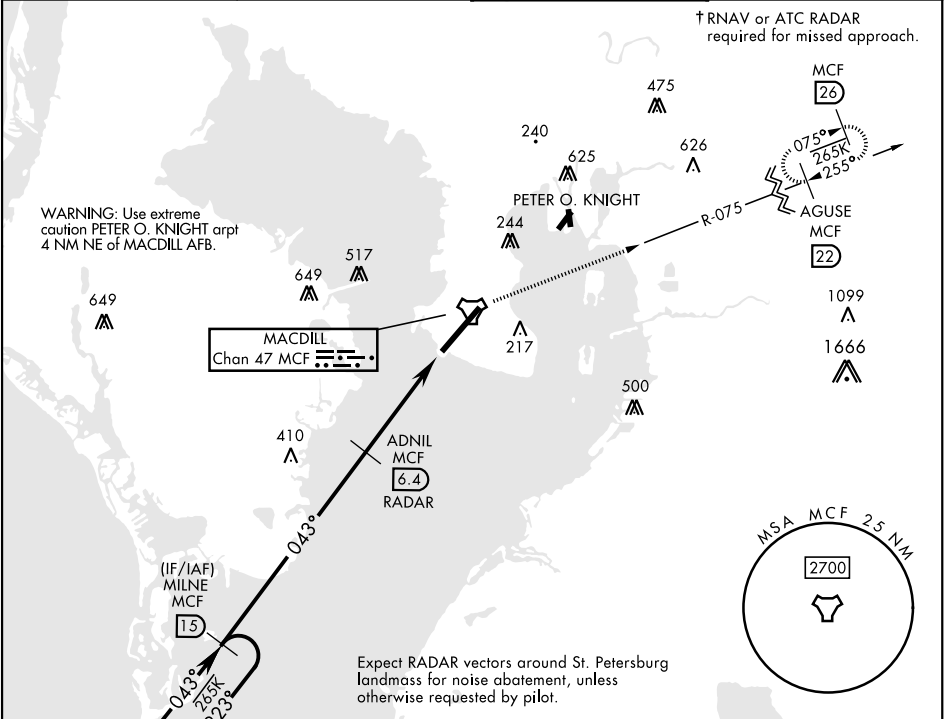

ELEV 14		TDZE 10	
1600		1600	
19		15	
MILNE R-223		ADNIL RADAR	
223°		043°	
043°		043°	
3.14°		TCH 56	
4.2 NM		0.5	
1700 MCF R-075		2700 MCF 22	
TACAN		FOROM	
2.9		2.2	
161		161	
11.42 x 151		043°	
TWR 97		A1	
A1		A1	
CIRCLING **		HIRL Rwy 5-23	