

WAPAX FOUR DEPARTURE (WAPAX4•WAPAX)

AL-1729 [USAF]


FAIRBANKS, ALASKA

Rwy	Knots	60	120	180	240	300	360
14 (9) (6) (3)	V/(fpm)	563	1126	1689	2252	2815	3378
32 (20) (16) (8)	V/(fpm)	612	1224	1836	2448	3060	3672

ATC Climb Rate

ATIS ★	119.9	273.5
CLNC DEL		
343.7		
GND CON		
121.8	275.8	
TOWER ★		
127.2	352.05	
FAIRBANKS DEP CON		
127.1	251.1	

- Ⓒ DER to 14,000 (AXSEM Transition)
- Ⓓ DER to FL220 (APPEL Transition)
- Ⓔ DER to FL200 (CABIN Transition)

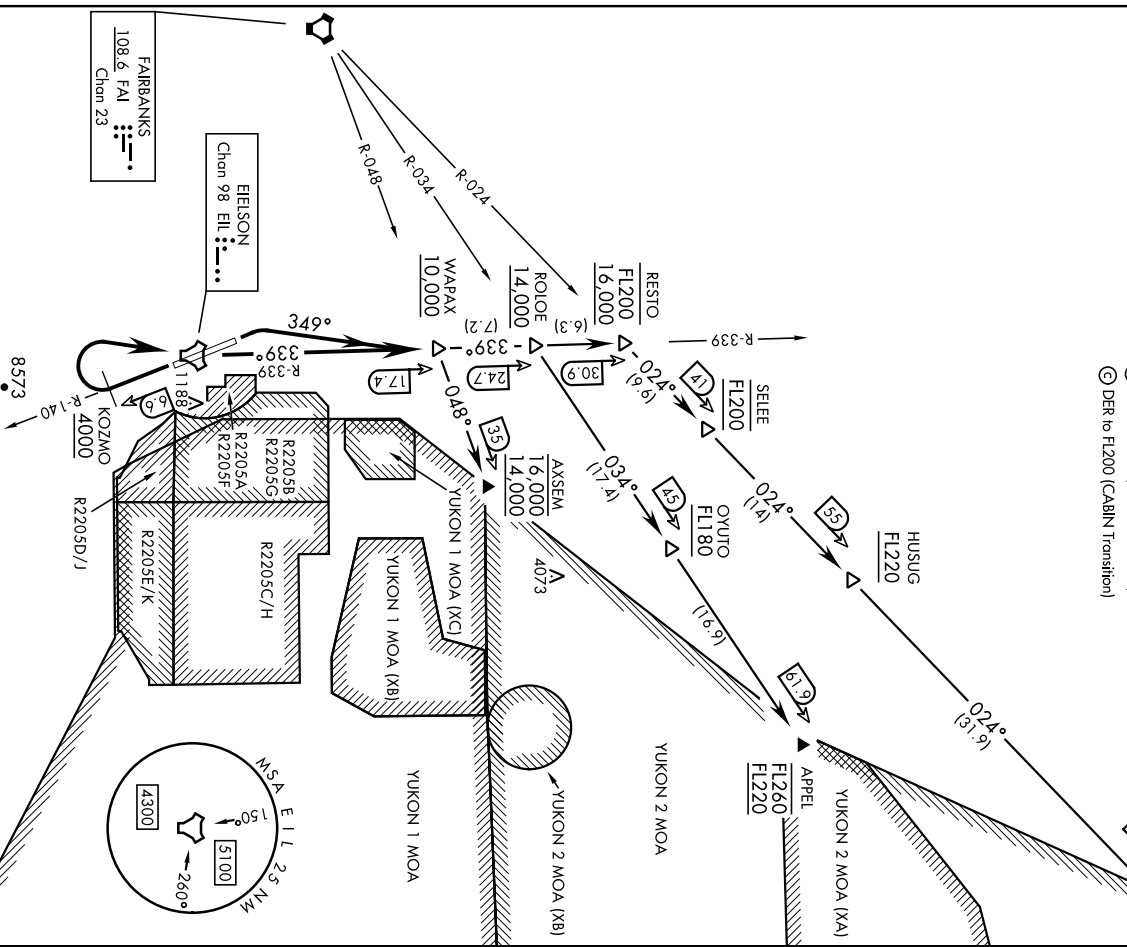

(NARRATIVE ON FOLLOWING PAGE)

WAPAX FOUR DEPARTURE (WAPAX4•WAPAX)

Orig 20APR23

FAIRBANKS, ALASKA
EIELSON AFB (PAEI)



DEPARTURE ROUTE DESCRIPTION

TAKEOFF RWY 14: Turn right to intercept EIL TACAN R-140 to KOZMO. Cross KOZMO at or above 4000, then turn right direct EIL to intercept EIL R-339 outbound to WAPAX. Cross WAPAX at or above 10,000. Thence . . .

TAKEOFF RWY 32: Turn right heading 349° to intercept EIL TACAN R-339 to WAPAX. Cross WAPAX at or above 10,000. Thence . . .

APPEL GATE TRANSITION (WAPAX4•APPEL): Cross ROLOE at or above 14,000. Turn right track outbound on FAI VORTAC R-034 direct OYUTO, direct APPEL. Cross OYUTO at or above FL180, cross APPEL at or above FL220 block FL260.

AXSEM GATE TRANSITION (WAPAX4•AXSEM): Turn right and track outbound on FAI VORTAC R-048 to AXSEM. Cross AXSEM at or above 14,000 block 16,000.

CABIN GATE TRANSITION (WAPAX4•CABIN): Cross RESTO at or above 16,000 block FL200. Turn right and track outbound on FAI VORTAC R-024 direct SELEE, direct HUSUG, direct CABIN. Cross SELEE at FL200, cross HUSUG at or above FL220, cross CABIN at or above FL220 block FL260.