



APP CRS 173°	Rwy Ldg	12000
	TDZE	5357
	Apt Elev	5434

RNAV (RNP) Z RWY 16L
DENVER INTL (DEN)

▼ For uncompensated Baro-VNAV systems, procedure NA below -25°C (-13°F) or above 45°C (114°F). GPS required. For inoperative MALSR, increase RNP 0.10 all Cats visibility to RVR 4000 and RNP 0.30 all Cats visibility to RVR 5000. Simultaneous approach authorized. Use of FD or AP providing RNAV track guidance required during simultaneous operations.	MALSR 	MISSED APPROACH: Climb to 5900 then climbing right turn to 10000 direct BINBE and hold, continue climb-in-hold to 10000.
--	--	---

D-ATIS 125.6 379.9	DENVER APP CON 119.3 307.3 (N) 120.35 379.3 (S)	DENVER TOWER 135.3 351.95	GND CON 121.35 379.175 (W) 121.85 377.1 (E)
------------------------------	---	-------------------------------------	---

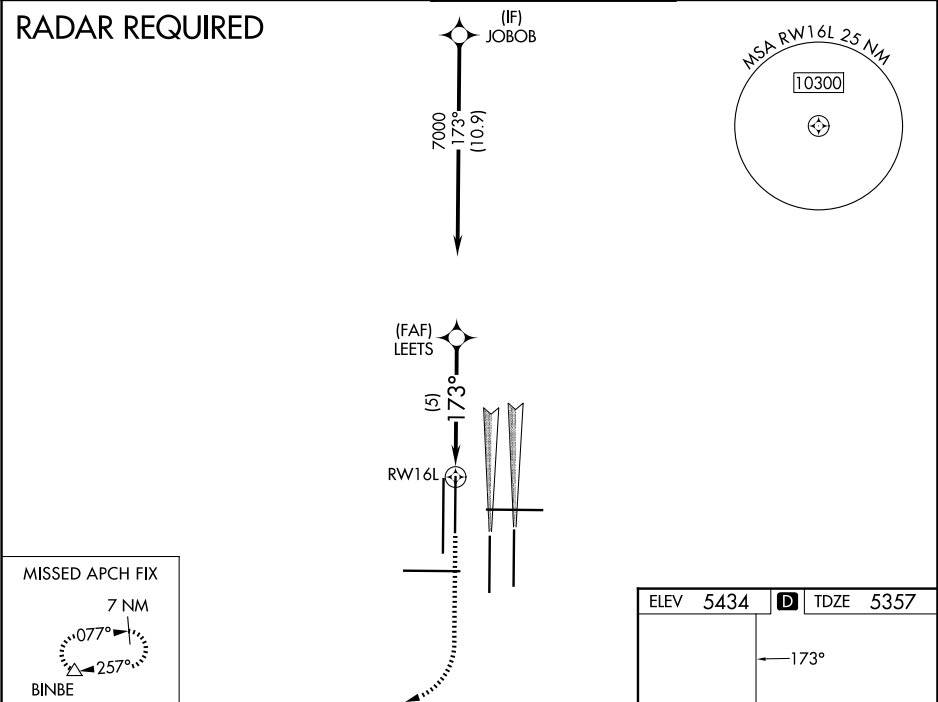

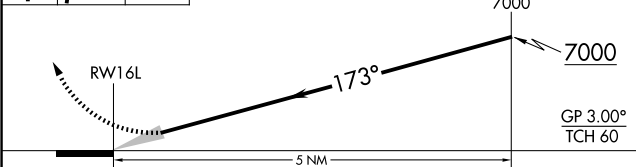5900	10000	BINBE	VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 71).	LEETS
				7000
				
CATEGORY	A	B	C	D
RNP 0.10 DA	5617/24 260 (200-½)			
RNP 0.30 DA	5683/32 326 (300-⅔)			
AUTHORIZATION REQUIRED				

